



**Government of the
People's Republic of Bangladesh**

**Department of
Public Health Engineering (DPHE)**

**Union Wise Water Technology Mapping
[Rangpur Circle]**



DPHE PUBLICATION # 04

May 2011

Government of the People's Republic of Bangladesh
Department of Public Health Engineering (DPHE)

Union Wise Water Technology Mapping
[Rangpur Circle]



Union wise Water Technology Mapping
GOB - UNICEF Project Areas (Rangpur Circle)

Published by:

Project Director
Sanitation, Hygiene and Water Supply Project (GOB - UNICEF)
DPHE, Dhaka

DPHE Publication # 3

R & D Publication # 3

May, 2011

All right reserved by:

Department of Public Health Engineering (DPHE)
Under Copy right Act. 28 of 2000

This book or any part of it can not be replaced/reprinted in any form or any means without prior written permission of the publisher (DPHE).

ISBN: 11652 COPER

Lay out: DPHE R & D Division, Dhaka

Cover design: DPHE Computer Division, Dhaka

Printed by: GOB-UNICEF Project

FOREWORD

Sanitation, Hygiene and Water Supply Project (GOB-UNICEF) has been approved with a boarder objective of reducing mortality by providing safe water, sanitation facilities to the communities and improving their hygiene behavior. Water supply is an important aspect of the project which should be free from bacteriological and chemical contamination. Rural water supply in Bangladesh is primarily dependent on low cost tubewell technology using ground water. The tubewell water received priority for being safe particularly from bacteriological contamination point of view. But identification of arsenic in ground water particularly in shallow aquifer appeared as a threat on the ground water based water supply system. This project also emphasizes on arsenic issue as well as safe water option for the community.

Water source of Bangladesh is complex in nature considering water chemistry and geology. As for example, spreading pattern of arsenic is not uniform. In one upazila, some unions are severally arsenic contaminated and some are not. However, arsenic contamination also varies with depth of aquifer for a particular place. Apart from arsenic, ground water source has been facing the problem of excessive iron, salinity and water table depletion. On the other hand, protected but perennial surface water source is not available in many parts of the country. So, one technology may not be suitable for the larger areas because of different hydro-geological situation. In that case the water technology is required to be identified on priority basis up to specific boundary, such as union boundary.

Under these circumstances, GOB – UNICEF Project decided in its 18th PMU (Project Management Unit) meeting held on 5th February 2008, to have good documentation of the valuable outcomes/contribution of DPHE on different issues concerning the WSS sector as DPHE publication, so that, these get preserved for future use and reference.

Based on the PMU decision initiatives have been taken to prepare union wise technology mapping to support the community for preparing their Community Action Plan (CAP) and selecting the suitable water option for that area. Under these initiatives DPHE Ground Water Circle prepared union wise technology mapping based on the available hydro-geological data, National Policy for Arsenic Mitigation 2004 and Implementation Plan of Arsenic Mitigation in Bangladesh and consultation with concerned DPHE field offices.

This document contains the basic concept along with advantages and limitations of different water options. It also gives an outline of different steps to be followed to select the options.

This is just a beginning, there might be some information gaps for selecting the suitable option. Moreover, people's acceptability is an important issue to be taken into consideration during implementation.

I would like to express my gratitude to UNICEF for providing necessary support in preparing this document. I also gratefully acknowledge the contribution of Mr. S M Ihtishamul Huq, SE, Groundwater Circle, Mr. Sudhir Kumar Ghosh, SE, DPHE and Mr. Md. Shahidul Islam, Jr. Hydro geologist, R & D Division for preparing this documentation. I would also like to thank DPHE field-level officers for their valuable contribution in the experience sharing workshop.

We hope, in course of time, this document will be updated and upgraded with more information and field experiences and this initiative will be instrumental in preparing union wise technology mapping for the whole country.

(Md. Nurul Islam)
Project Director, DPHE
Sanitation, Hygiene and Water Supply Project (GOB-UNICEF)

Table of Content

1.0	Background	1
2.0	Objective	1
3.0	Project area	2
4.0	Adopted procedure	2
5.0	Issue of water source	3
6.0	Arsenic mitigation	3
6.1	Criteria of Arsenic Mitigation Option	3
6.1.1	Dug well	4
6.1.2	Pond sand filter	5
6.1.3	Improved deep tubewell	6
6.1.4	Rain water harvesting	6
6.1.5	Arsenic removal technologies	7
7.0	Low Water table technology	8
8.0	Salinity problem	10
9.0	Iron Removal Technology	10
10.0	Union Wise Technology	10
11.0	Use of Union wise Technology Mapping Documentation	11
Annex	– A (List of Project upazilas)	12
Appendix	– 1 (Excel table on union-wise technology)	
Appendix	– 2 (Union -wise Technology Mapping)	

1.0 Background:

Sanitation, Hygiene and Water Supply Project (GOB-UNICEF) has been approved having broader perspective of reducing mortality through providing safe water, sanitation facilities and improved hygiene behavior. Water supply is an important aspect of the project and supplied water should be free from bacteriological and chemical contamination as well.

Rural water supply in Bangladesh is predominantly based on ground water. But identification of arsenic in ground water particularly in shallow aquifer causes threat on ground water based water supply system. The project emphasizes on arsenic issue for providing safe water to the community. Arsenic has been identified in 271 upazilas of which 29% tube wells are found arsenic contaminated in terms of Bangladesh standard (50ppb). Spreading pattern of arsenic is sporadic, not uniform. In one upazila, some unions are severally arsenic contaminated and some are not like that. However, arsenic contamination also varies with depth of aquifer for a particular place.

The ground water of Bangladesh is extremely complex in terms of water chemistry and geology as well. On the other hand, protected but perennial surface water source is not available in many parts of the country. So, one technology may not be suitable for the larger areas because of different hydro-geological situation. In that case the water technology is required to be identified on priority basis up to specific boundary, such as union level.

According to project approach, water points will be installed through the process of community action plan (CAP). During preparation of CAP, the community should be provided with the understandable ideas about the water option so that they can rightly choose the option by themselves. In this regard Project Director, Sanitation, Hygiene and Water supply project vide his memo no 650 date 19 February 2007 requested DPHE Ground Water Circle to provide assistance in preparation of union wise technological map for the GOB – UNICEF project area.

In this context, initiatives have been taken by DPHE Ground Water Circle in consultation with SHWAB project and WES section of UNICEF to prepare the technological map for the project areas.

2.0 Objective of Task:

- Identification of the union wise water supply technology based on hydro-geological situation of the particular areas.
- Preparation of the GIS mapping on union wise water options.
- Provide information to the water user group for preparation of CAP

3.0 Project area:

The project area of the GOB-UNICEF project has been classified as follows:

- ❑ 1st Batch: 635 union of 60 upazilas
- ❑ 2nd Batch: 439 union of 44 upazilas
- ❑ 3rd Batch: 600 paras of 16 upazilas

Technology Mapping for the project upazilas has been planned to be done batch wise.

4.0 Adopted Procedure :

1. Union wise basic data regarding lowest water table, arsenic contamination, iron and salinity problem available in Ground Water Circle has been furnished in a table (Union wise technology 1993 as reference).
2. Based on basic information, a desk review has been made to primarily identify union-wise technology analyzing the hydro-geological situation of that particular area. In most cases particularly in the arsenic affected unions, two or more options were identified on priority basis. The forecasting of groundwater level in year 2010 is considered as maximum water level in the area.
3. The primarily identified union wise technology list was provided to the DPHE SEs, EEs and SAEs to facilitate their participation in the workshop
4. DPHE Circle wise workshops were held with the participation of concerned Superintending Engineer, Executive Engineer, Assistant Engineer and Sub-Assistant Engineer. Representatives from Ground Water Circle, GOB-UNICEF project, personnel from WES section of UNICEF were present to facilitate the workshop.
5. The workshops discussed the experience and views of the field officer focusing on technology table prepared by DPHE Ground Water Circle and along with the policy guidelines particularly “National Policy for Arsenic Mitigation 2004 and Implementation Plan for Arsenic Mitigation in Bangladesh”.
6. Incorporating the findings of Workshop, the technology table has been send to concerned SEs, EEs and SAEs.
7. Based on the feed back from the field, technology table has been finalized, on basis of that GIS map for union-wise technology has been prepared.

5.0 Issue of the water source:

The problems of water source have been discussed which are as follows:

- i. Lowering of water table
- ii. Arsenic contamination in ground water particularly in shallow aquifer
- iii. Salinity in ground water
- iv. Iron & Manganese in ground water
- v. Non availability of suitable aquifer or rocky/hard layer
- vi. Non-availability of protected and perennial surface water source round the year

6.0 Arsenic Mitigation Option:


The project has given importance on arsenic mitigation approach as arsenic contamination emerges as a great concern for ground water based rural water supply system in Bangladesh. The project area and arsenic contamination is shown in Map as Annex- B. Different Arsenic mitigation options has been discussed following “National Policy for Arsenic Mitigation 2004 & Implementation Plan for Arsenic Mitigation in Bangladesh”. The mitigations options are:

- ❑ Dug/Ring Well
- ❑ Pond Sand Filter
- ❑ Deep Tubewell
- ❑ Rain Water Harvesting as promotional option and
- ❑ Arsenic Removal Technology (ART)

6.1 Criteria for Arsenic Mitigation Option:

Regarding identification of the Arsenic Mitigation Option, the criteria including the potentialities and limitation of each option were discussed in contrast with hydro-geological situation for the particular area considering the guidelines mentioned in the “National Policy for Arsenic Mitigation 2004 & Implementation Plan for Arsenic Mitigation in Bangladesh”. According to the said policy guidelines PSF and dug well will be tried first. If these technologies are found not feasible deep tubewell could be tried following the “Protocol for sinking Deep Tubewells in Arsenic contaminated areas”.

It was also advised that not only the technical aspect but O&M and user friendliness should be taken under consideration for selecting the options to make it sustainable. The main feature and basic criteria for each of the option are presented as follows:

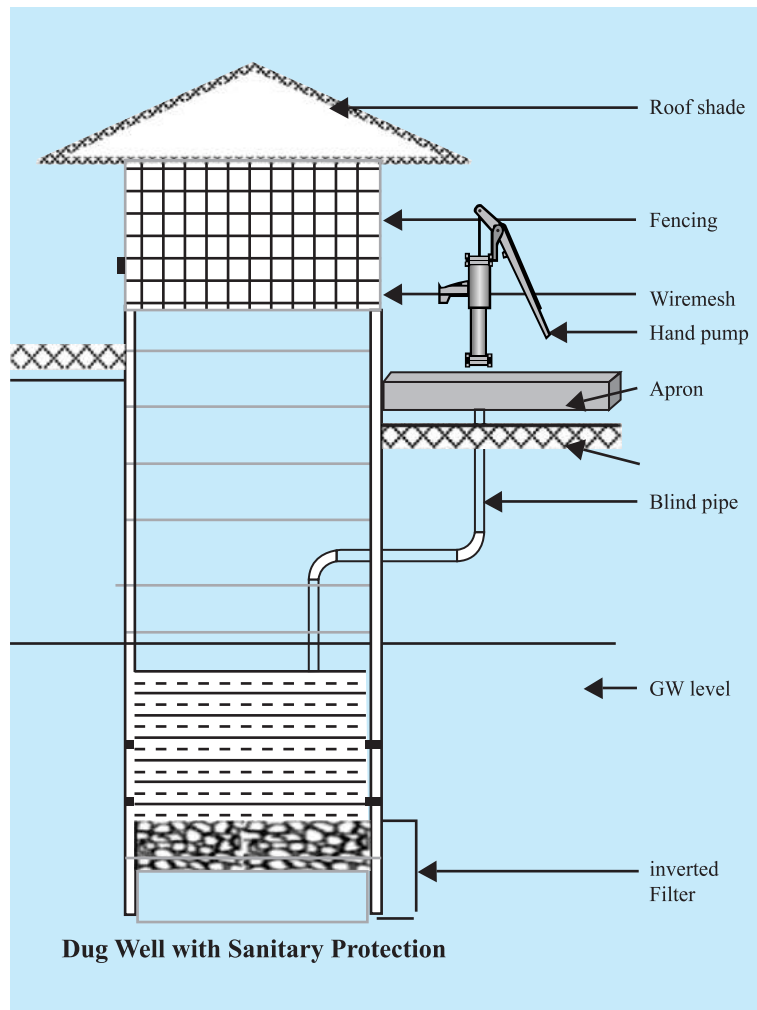

6.1.1 Dug Well:

Dug well is the oldest method of groundwater with-drawal for water supplies. The water of the dug well has been found to be free from dissolved arsenic and iron even in locations where tubewells particularly in shallow aquifer are contaminated.

Pre-requisite criteria

- There should be stable soil layer at the top (a clay layer is preferable)
- Presence of sandy layer within 9 to 12 m

Not Feasible

- Areas with the loose sandy soil
- Areas with more than 15m consolidated clay.

- Tidal zones of the costal belt.
- Areas of stony hills
- Area of peaty soil should be avoided for DW as these cause an unpleasant taste and smell.


Design Requirements:

- Concrete rings of 1.0 to 1.2 m in diameter used as lining.
- Wells should be at least 1.0 to 1.5 m deeper than the lowest water table in the driest month.
- Dug well should be constructed in the dry season to ensure availability of water round the year.
- Test well is to be drilled prior to construction of ring well to make sure about the soil condition and water quality.
- The well lining should be extended at least 0.5m above the ground to form a 'head wall' around the outer rim of the well.
- A concrete apron, about 2 m in width, should be constructed on the ground surface extending all around the outer rim of the well.
- The intake of water from a dug well can alternatively be made using float.

Very Shrouded Shallow Tubewell (VSST) can be considered as option in the DW area at the same depth. The availability of water in saturated zone should be ensured in this case. The main feature of this technology is the shrouded with coarse sand around the filter area. This is a low cost technology. This technology is also used in the saline problem areas.

6.1.2 Pond Sand Filter:

Pond sand filter is a surface water treatment option which is primarily a slow sand filter unit. If the turbidity of water is high then, there is necessity to use horizontal roughing filter.

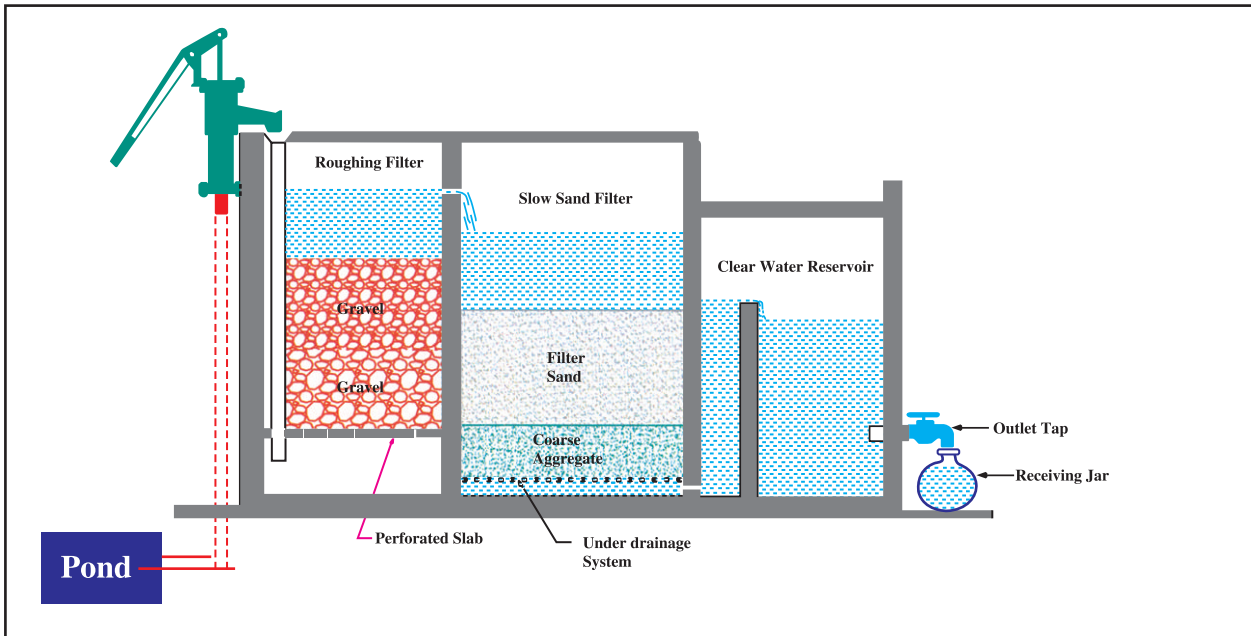


Raw water from pond is pumped up from a pond; the turbidity gets down through the roughing filter and then discharged into the filtration unit. The water is filtered and then collected in a clear water reservoir by an under drainage system. PSF is a good option for arsenic mitigation as well as for salinity prone areas

Pre- requisite criteria

- Viable alternative water supply option where perennial rivers, canals, fresh water lakes and ponds of acceptable water quality are available.
- Regular maintenance is crucial for the effectiveness of PSF
- Such maintenances need high level of community mobilization and proper attention to ensure safe water particularly from bacteriological contamination.

Design Criteria

- The horizontal roughing filter is divided into 3 parts: inlet tank, gravel zone and outlet tank. The gravel zone consists of 3 chambers loaded by different size of gravel (5-15 mm).
- The Sand Filter bed should be composed of 0.22 mm – 0.35 mm fine sand with a thickness of 60 to 120 cm. There is also a layer of coarse aggregate below the fine sand to support the sand against washing out through under drainage system. The uniformity coefficient should be from 2 to 3. The size of the gravel is 5-15 mm
- The filtration rate through SF is 0.2 – 0.3 m/hr and through roughing filters 1.5-2.0 m/hr.

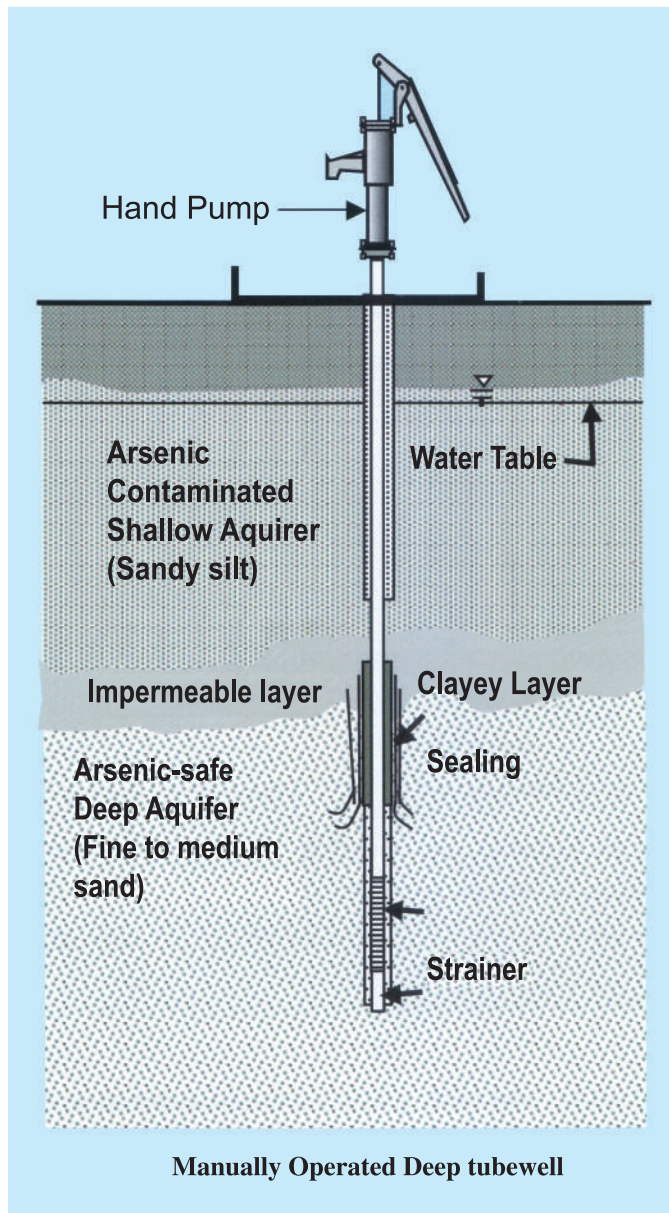

6.1.3 Improved Deep Tubewell

The deep aquifers in Bangladesh have been found to be relatively free from arsenic contamination. The aquifers in Bangladesh are stratified and in some places the aquifers are separated by relatively impermeable strata. Deep tubewells installed in those protected deeper aquifers are producing arsenic safe water. Sealing in the impervious layer is done to prevent the leaching of arsenic through path way created during drilling of the well.

Pre-requisite criteria

- It can be installed where shallow aquifer is separated from deeper aquifer by substantially thick impervious layer.
- It can be installed in the coastal areas of Bangladesh having safe aquifer.

Design Requirements

- The entire tube well should be installed straight and vertically deep bore hole is required therefore.
- The annular space of bore holes of the deep tube wells are required to be sealed at the level of impermeable strata.
- The entire tube well should be installed straight and vertical.

6.1.4. Rain Water Harvesting


Rainwater harvesting is a technology to collect rainwater for its use in drinking purposes. About 203 cm rainfall occurs annually in Bangladesh. The rain water is safe if it maintained hygienically. The main limitation of this option is non-availability of rain water round the year. But it can be widely used as supplementary source. As per "National Policy for Arsenic Mitigation 2004 & Implementation Plan for Arsenic Mitigation in Bangladesh" the government's role is mainly to conduct promotional activities for RWH.

Pre- requisite criteria

- Feasible where average rainfall is 1600 mm per annum.
- There should have required catchment area for rain water harvesting

Design Criteria

- Rain water has 3 basic units. 1. The catchment area (like corrugated roof top) and 2. Supporting collection system (gutter and collection pipe) and 3. Storage tank.
- Catchment zone can be a corrugated tin-shed, sloped flat roof top, polythene sheet etc.

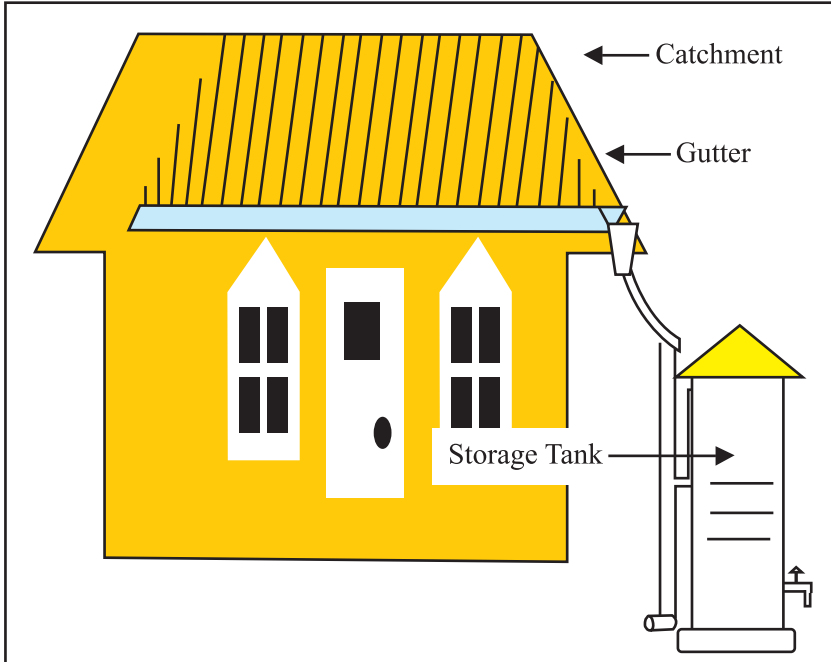

- The tank can be made of GI, ferro-cement, burned clay (motka), plastic etc.
- The collection pipe should have an exit way beyond the connection with storage tank to let the first flush flow away.
- The down pipe should have net to bar mosquitoes, flies from entering into the storage tank.
- There should be an end plug to stop flush discharge to enter water into the storage tank after flushing.

- The location should be so selected that it allows accessibility of people.

6.1.5 Arsenic Removal Technology (ART):

ARTs are the chemical options which remove arsenic mainly using media. Four options are certified by BCSIR of which three are house hold and one is community based. These can be selected as a last effort particularly where deep tubewell and Dug well is not feasible. Filter media have to be changed after the media being clogged. The quality of raw water is specified for each technology.

The main features of the ARTs are given below:


Name of ARTs	Filter rate	Total Treatment
Sono (House hold)	16 lit/hr	8100 liter
Alkan (House hold)	120 lit/hr	8100 liter
Read-F (House hold)	60 lit/hr	40,000 liter
SIDKO (Comm unity)	240 liter/hr	1,21,500 liter




Note : 2 (two) more technologies Nelima and Shodesh have further been certified by BCSIR

7.0 Low Water Table Technology:

Lowering of water table is big issue for the tubewell based rural water supply. In view of low cost, easy to O&M and availability in the market, suction mode number 6 pump is widely used as the tubewell technology. But its limitation is that it can not abstract water beyond the 26 ft depth of water table. In that case force mode pump has to be used. Earlier direct action pump was used. In some cases where the depth of water table is marginal, in that case Tara tube well may be given preference. Now Tara-dev head pump (lever action) is being used which can abstract water upto 80-90 ft depth of water table. The component of direct action & Tara dev pumps are shown as below:

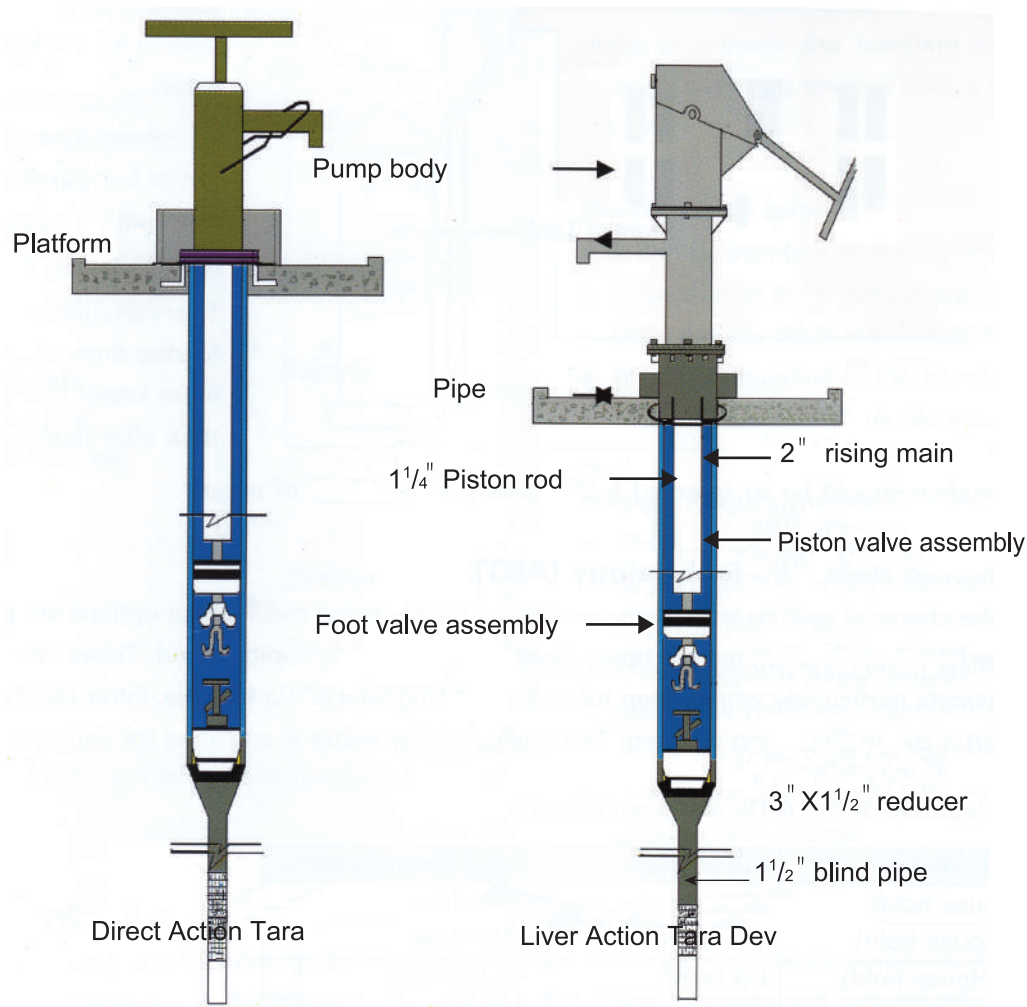

In selecting the areas of low water table in the project upazilas, the study on forecasting groundwater level declination in Bangladesh conducted in early 1990 has been used and the delineated low water table map for 2010 is considered as the reference of maximum depth to water level. The pump technology is then selected for the union.

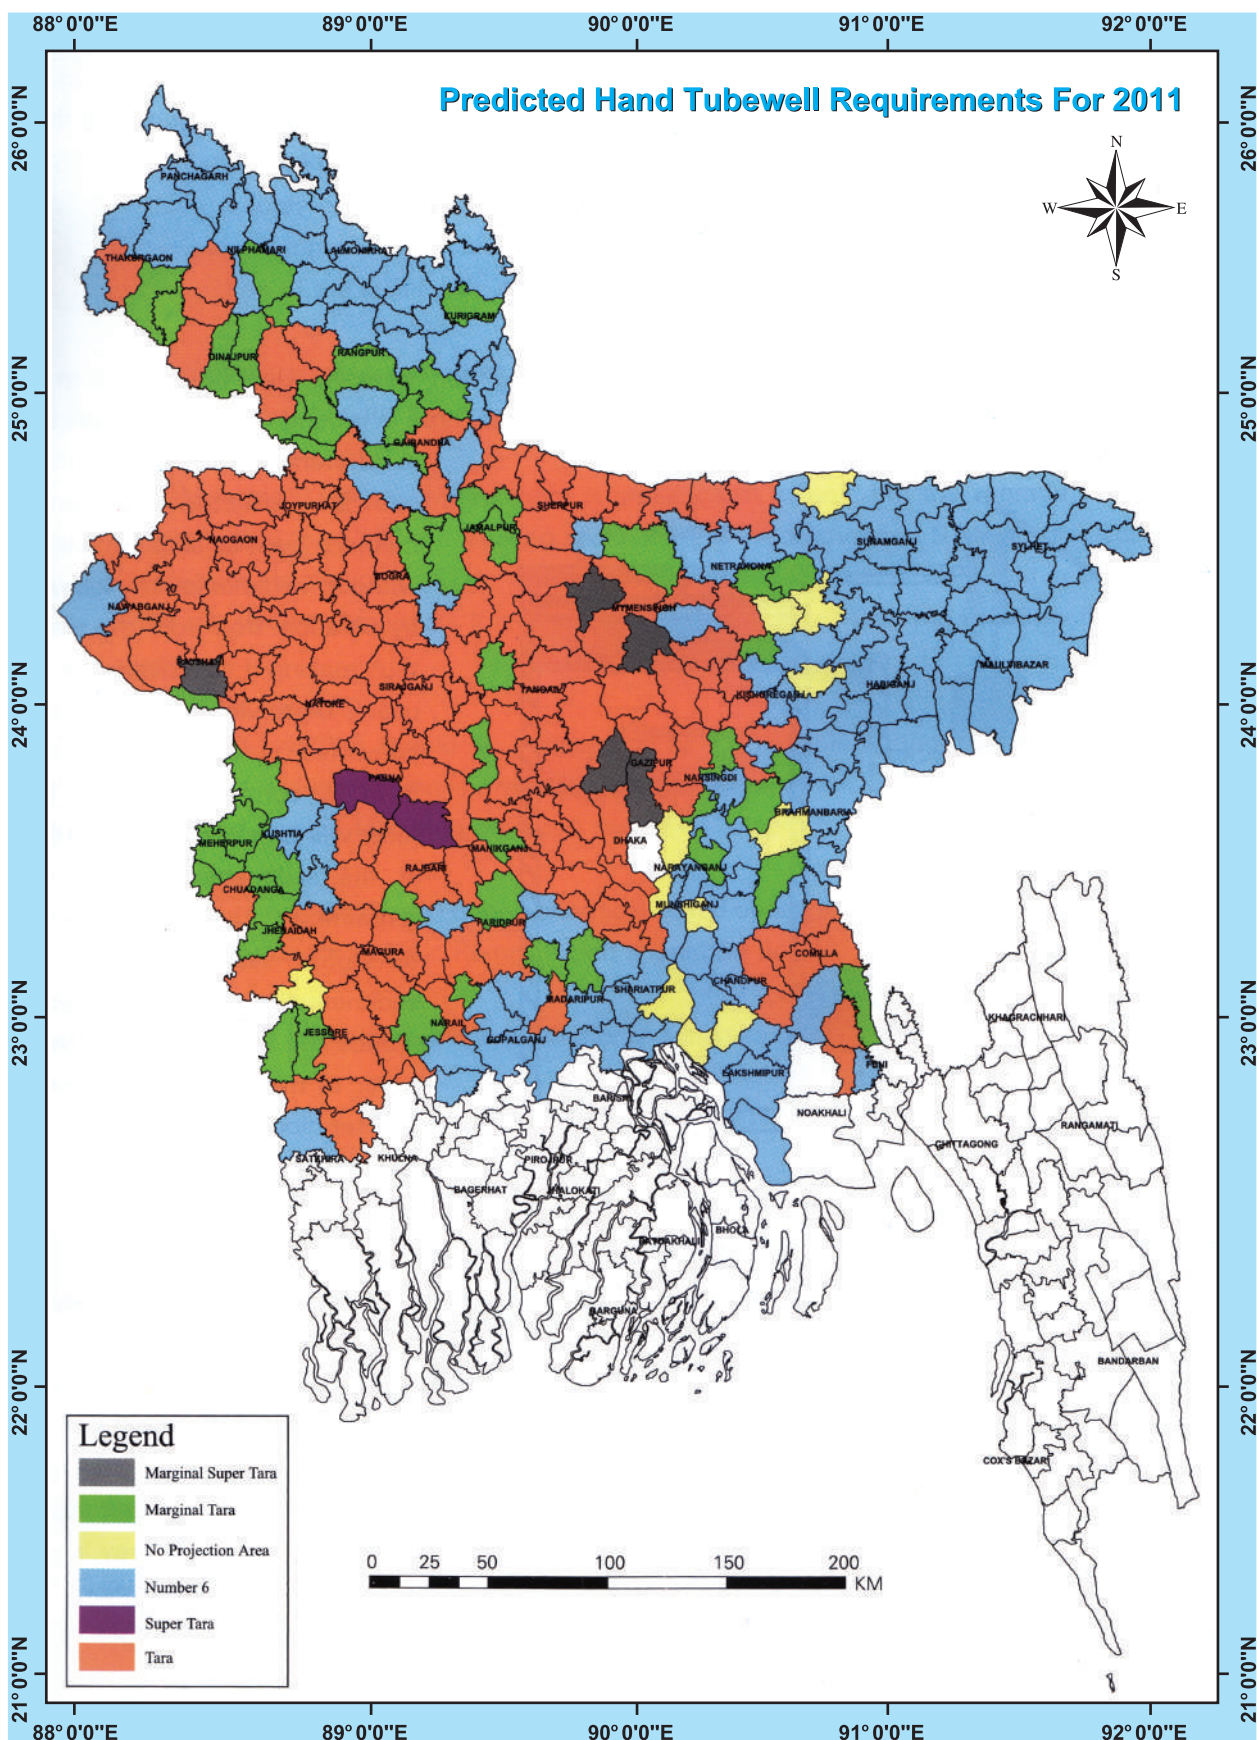


8.0 Salinity problem:

Salinity problem is now not limited in the coastal belt rather salinity intrusion is now expanded in the various part of the country. Deep tubewell and PSF are the best feasible option in this area. It is to be mentioned that RWH is a suitable option as average rainfall is high in the coastal belt. The VSST is also an option in the coastal belt.

9.0 Iron Removal Technology:

Iron content exceeding 5mg/l will require treatment using Iron Removal Unit (IRU). It is to be mentioned

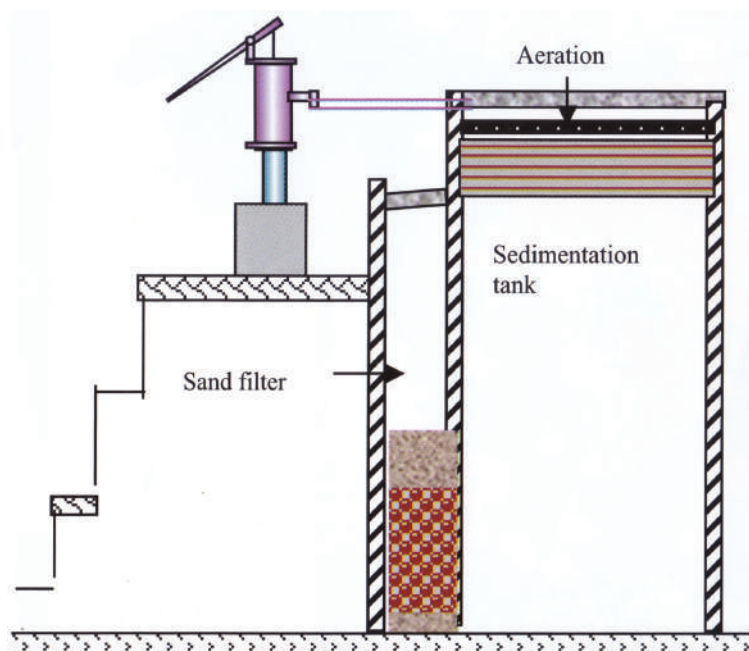

that concentration of Iron varies with different aquifer. Iron in ground water may be present in different forms and its removal can be effected by simple methods such as aeration with or without sedimentation followed by filtration. Iron from the water, thus making it acceptable for the users. Dissolved iron in water is converted into insoluble ferric form in contact with air. This form will be removed by settling in the sedimentation tank and remaining by the filtration through sand filter. The sedimentation tank is required to reduce the load on sand filter in order to minimize the frequency of filter clogging.

10.0 Union Wise Technologies:

A set of technologies has been recommended for each union on priority basis based on the available hydro-geological information, the views of field personnel & policy guidelines. However, these technologies have to be implemented systematically ensuring the participation of communities. According to the project guidelines the water options will be selected following the community action plan ensuring the active participation of community. So proper knowledge about the option shall have to be provided to the community so that the option can meet the basic criteria of the water supply such as safe, adequate and reliable round the year. It is to be mentioned that if a technology is new for the particular area, utmost care should be taken for its implementation and replication. The experience regarding implementation of the technologies in the field will be helpful for upgrading the technological mapping and for proper application of the technologies.

11.0 Use of Union wise technology Mapping document:

It has been proved from different studies that hand pump system of water options particularly Shallow and Deep hand pump tube wells are very much popular among the community. But the arsenic contamination in groundwater compelled the implementer of water supply to switch over to different alternative water supply options in the arsenic affected areas. The technology in a union has been recommended considering the Arsenic Policy 2004 and its Implementation Plan along with other particular information of the locality. In implementing water supply options the following steps should be followed:

- a) In all cases arsenic and other required water quality parameters need to be tested before the system is brought to operation.
- b) In the villages/unions where there is presence of arsenic but the average contamination level is less than 5%, the existing technology is recommended STW. In that case, before going for installation of STW, testing of arsenic of 5 to 10 tube wells within 500 meters of the site need to be tested. If any tubewell shows arsenic >0.01 mg/L, follow the alternative option.
- c) Dug well and PSF should be investigated as the feasible option of alternative of STW. If sufficient documentation is available about its failure in the locality then Deep tubewell with modified design(following protocol) should be adopted.
- d) In case of non-successful of non chemical based option (STW, DW, PSF and DTW) chemical based option for Arsenic Removal Unit should be used as the technology.
- e) In all cases in problem areas promotional activities on RWH should be done.

**Upazila Project area
of
Sanitation, Hygiene and Water Supply (GOB-UNICEF) Project
under
Rangpur Circle**

Serial No	Name of District/Pourashava	Name of Upazila	No of Union	Total no of UPs
1	Gaibandha	Sadar	13	39
2	Gaibandha	Polashbari	9	
3	Gaibandha	Gobindaganj	17	
4	Panchagar	Sadar	10	27
5	Panchagar	Debiganj	10	
6	Panchagar	Tetulia	7	
7	Rangpur	Sadar	10	35
8	Rangpur	Badarganj	10	
9	Rangpur	Taraganj	5	
10	Rangpur	Gangachhara	10	

District: Gaibandha

Upazila: Sadar
Polashbari
Gobindaganj

**Table
For**

Mapping on 'Water Supply Technology' under "GOB-UNICEF Project"

District Name	Upazila Name	Union Name	Water Supply Technology													Remark					
			Lowest Water Table (LWT), 2007 in Feet	% TW As Contami nation	Fe Problem (>5 ppm) Yes/No	Cl Problem (>600 ppm) Yes/No	Techno logy option as per 1993	Average depth of Tube well in Feet	Recommended options on the priority basis:												
									STW	DTW	STW	DTW	STW	DTW	STW		DTW	1	2	3	4
Gaibandha	Gaibandha sadar	Badiakhali	17	-	N/D	Yes	-	No	-	ST-SU	60	-	STW-SU								
Gaibandha	Gaibandha sadar	Ballamjhar	16	-	N/D	Yes	-	No	-	ST-SU	55	-	STW-SU	DW-SU							
Gaibandha	Gaibandha sadar	Boali	15	-	N/D	Yes	-	No	-	ST-SU	65	-	STW-SU								
Gaibandha	Gaibandha sadar	Ghogoa	17	-	N/D	Yes	-	No	-	ST-SU	50	-	STW-SU								
Gaibandha	Gaibandha sadar	Gidari	16	-	N/D	Yes	-	No	-	ST-SU	50	-	STW-SU								
Gaibandha	Gaibandha sadar	Kamarjani	17	-	N/D	Yes	-	No	-	ST-SU	65	-	STW-SU								
Gaibandha	Gaibandha sadar	Kholahati	17	-	N/D	Yes	-	No	-	ST-SU	50	-	STW-SU	DW-SU							
Gaibandha	Gaibandha sadar	Kuptala	16	-	N/D	Yes	-	No	-	ST-SU	50	-	STW-SU								
Gaibandha	Gaibandha sadar	Laksmipur	17	-	N/D	Yes	-	No	-	ST-SU	65	-	STW-SU								
Gaibandha	Gaibandha sadar	Malibari	17	-	N/D	Yes	-	No	-	ST-SU	60	-	STW-SU								
Gaibandha	Gaibandha sadar	Mollarchar	17	-	N/D	Yes	-	No	-	ST-SU	55	-	STW-SU								
Gaibandha	Gaibandha sadar	Ramchandrapur	17	-	N/D	Yes	-	No	-	ST-SU	60	-	STW-SU	DW-SU							
Gaibandha	Gaibandha sadar	Shahapara	17	-	N/D	Yes	-	No	-	ST-SU	60	-	STW-SU	DW-SU							

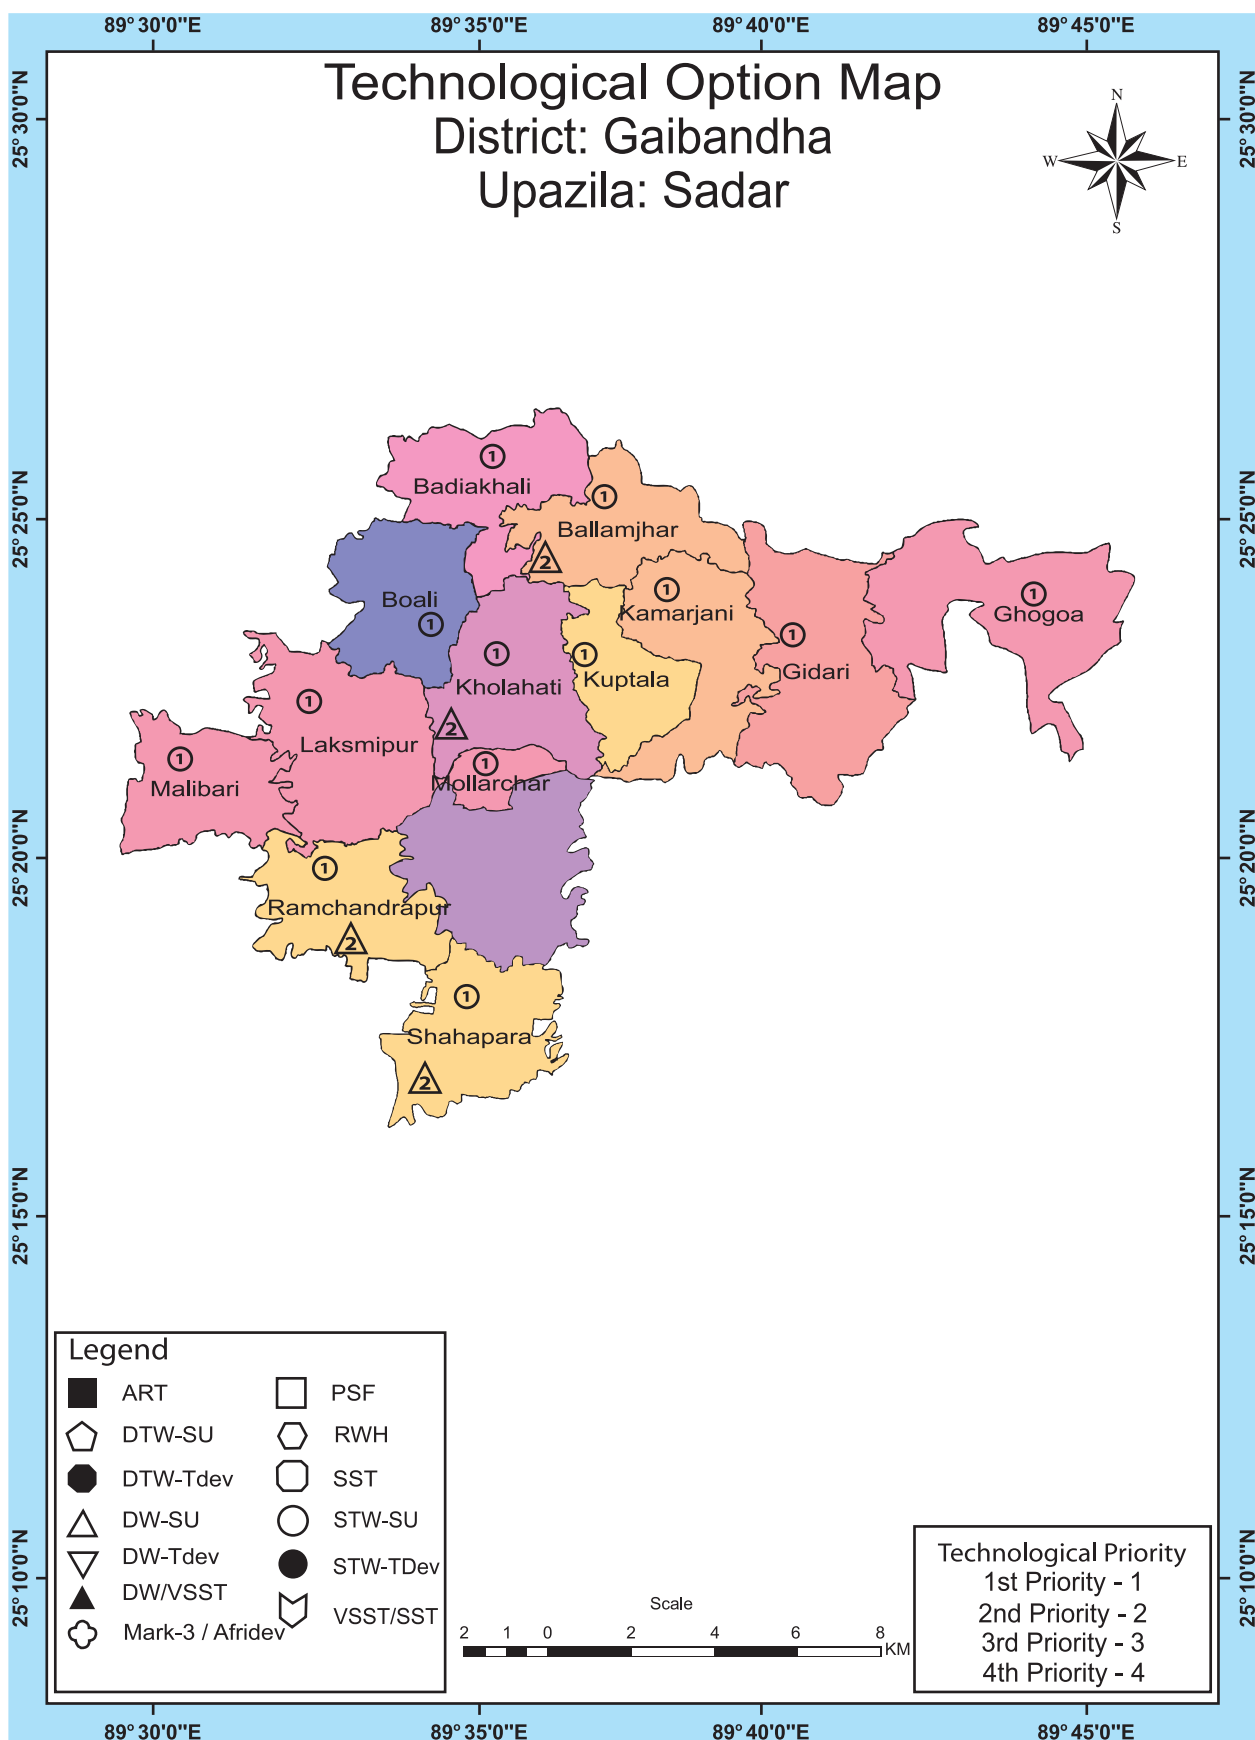
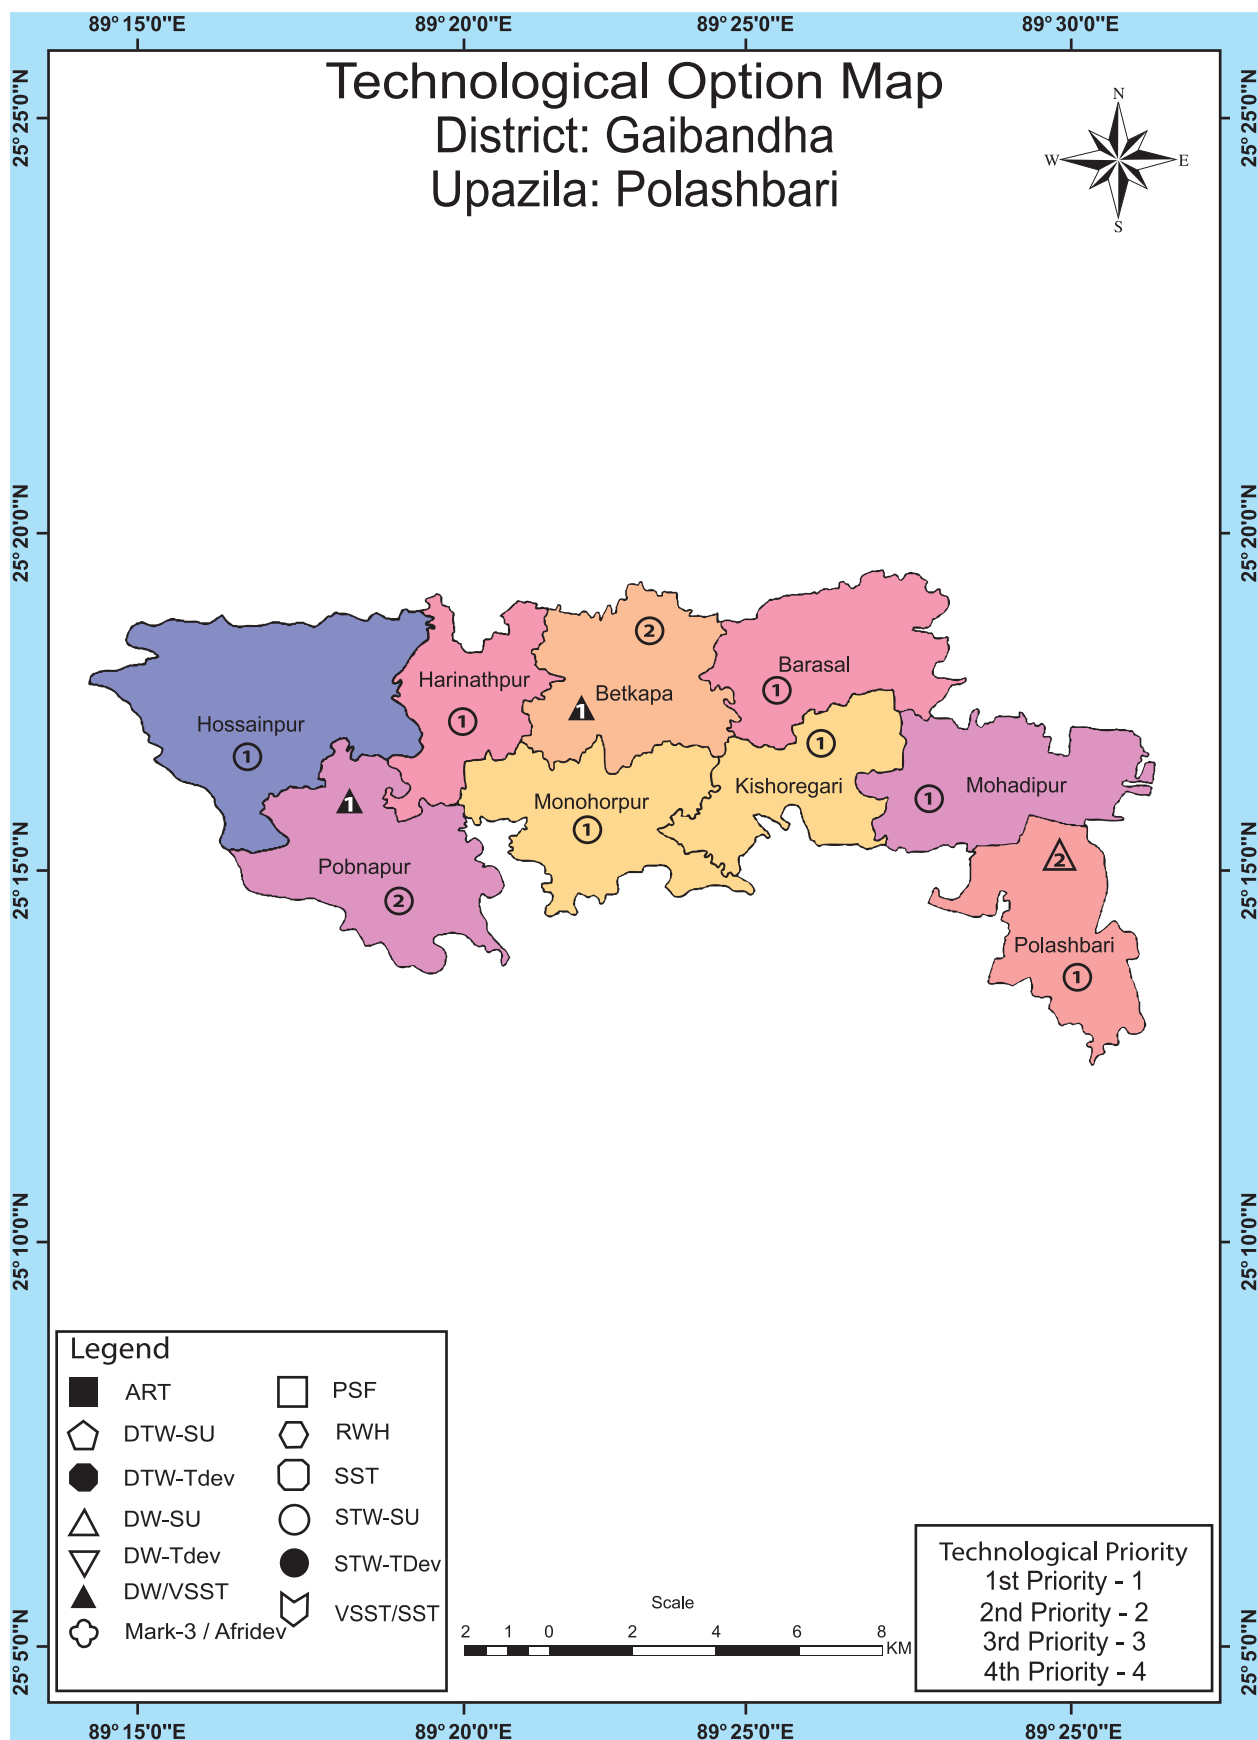
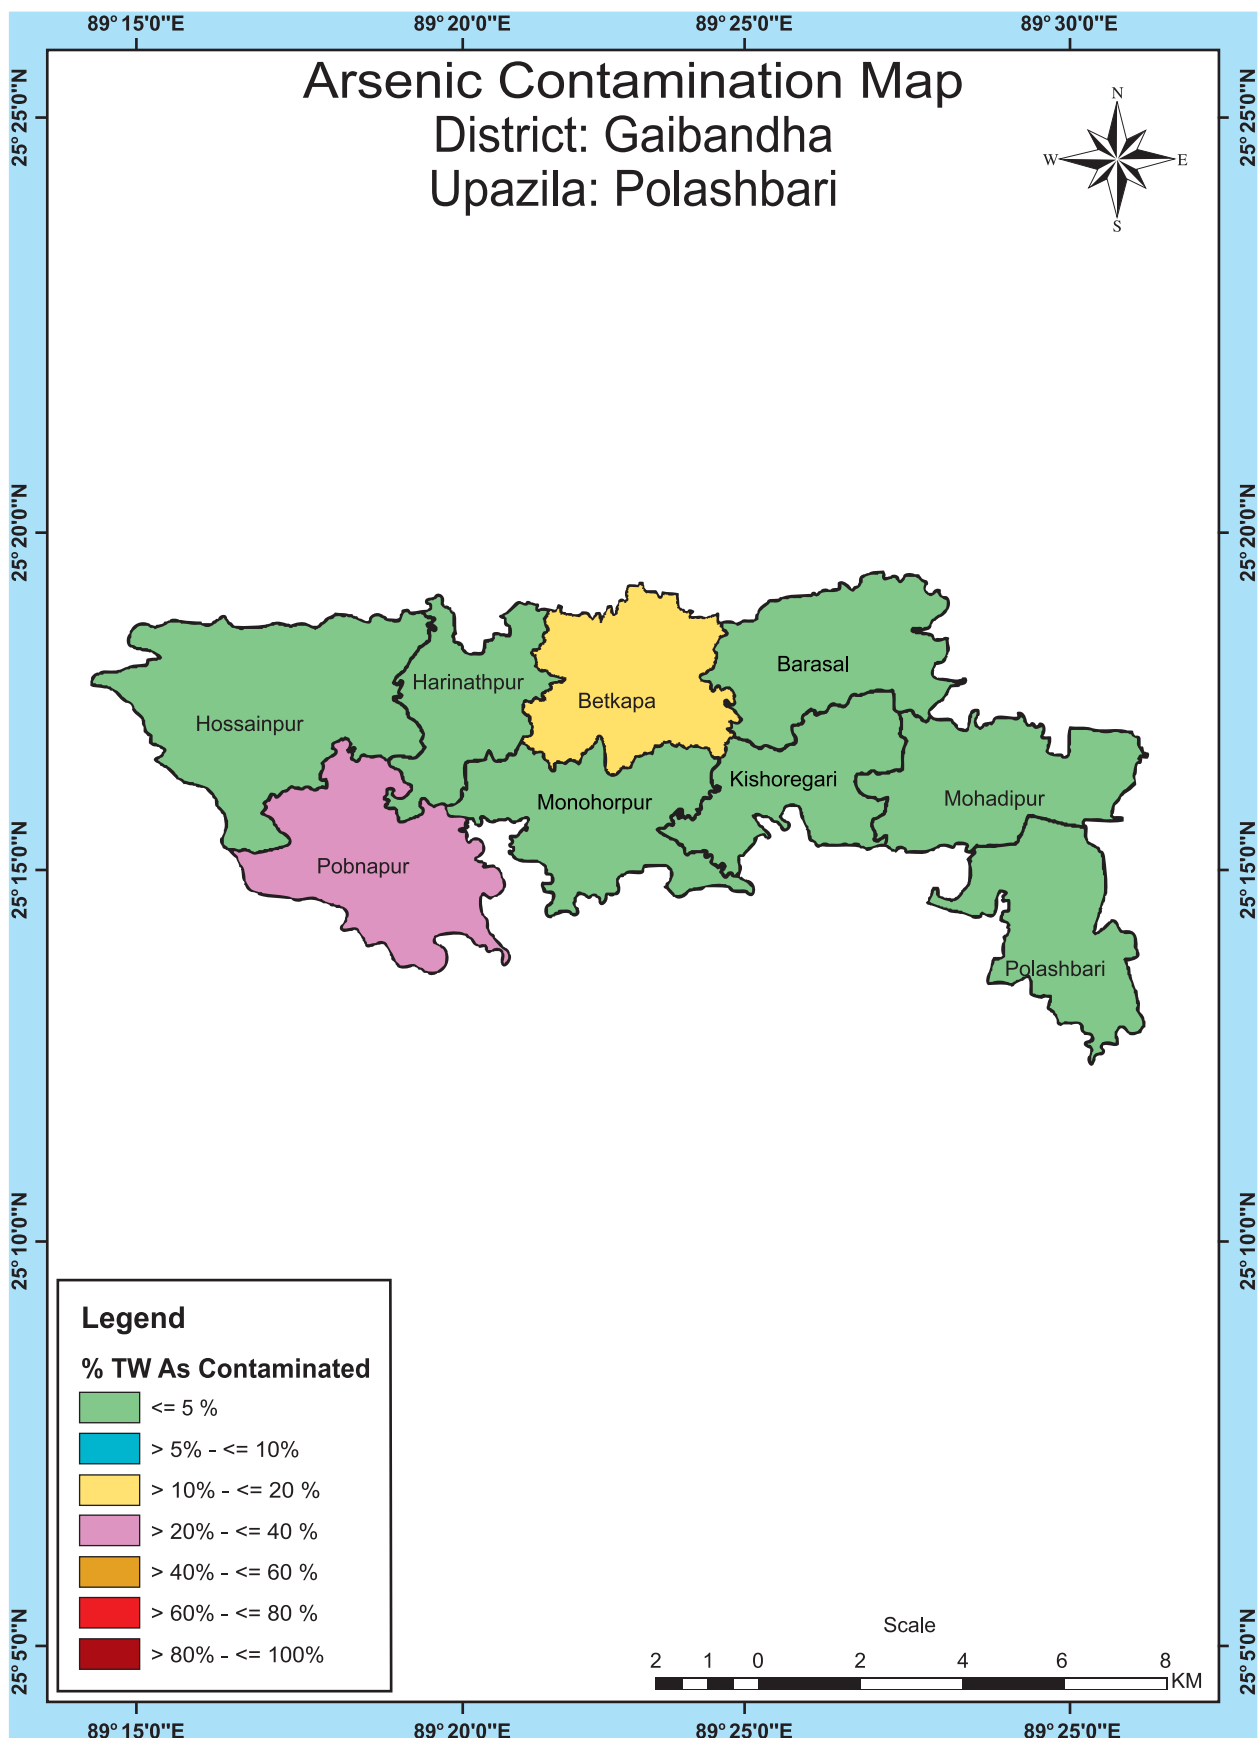


Table
For
Mapping on 'Water Supply Technology' under "GOB-UNICEF Project"

District Name	Upazila Name	Union Name	Water Supply Technology											Remark	
			Lowest Water Table (LWT), 2007 in Feet	% TW As Contamination	Fe Problem (>5 ppm) Yes/No		Cl Problem (>600 ppm) Yes/No		Technology option as per 1993	Average depth of Tube well in Feet	Recommended options on the priority basis: STW: Shallow Tubewell, No.6/T.Dev DTW: Deep Tubewell, No.6/T.Dev DW : Dug Well (Ring well) PSF: Pond Sand Filter ART: Arsenic Removal Technology				
					STW	DTW	STW	DTW			STW	DTW	1		2
Gaibandha	Polashbari	Barasal	16	-	3.57	Yes	-	No	-	ST-SU	50	-	STW-SU		
Gaibandha	Polashbari	Betkapa	17	-	18.12	Yes	-	No	-	ST-SU	50	-	DW/VSST	STW-SU	
Gaibandha	Polashbari	Harinathpur	16	-	2.67	Yes	-	No	-	ST-SU	65	-	STW-SU		
Gaibandha	Polashbari	Hossainpur	19	-	0.5	Yes	-	No	-	ST-T1	60	-	STW-SU		
Gaibandha	Polashbari	Kishoregari	20	-	0.24	Yes	-	No	-	ST-SU /ST-T1	60	-	STW-SU		
Gaibandha	Polashbari	Mohadipur	15	-	4.43	Yes	-	No	-	ST-SU	50	-	STW-SU		
Gaibandha	Polashbari	Monohorpur	18	-	4.53	Yes	-	No	-	ST-SU	50	-	STW-SU		
Gaibandha	Polashbari	Pobnapur	18	-	26.78	Yes	-	No	-	ST-SU	50	-	DW/VSST	STW-SU	
Gaibandha	Polashbari	Polashbari	17	-	1.22	Yes	-	No	-	ST-SU /ST-T1	45	-	STW-SU	DW-SU	






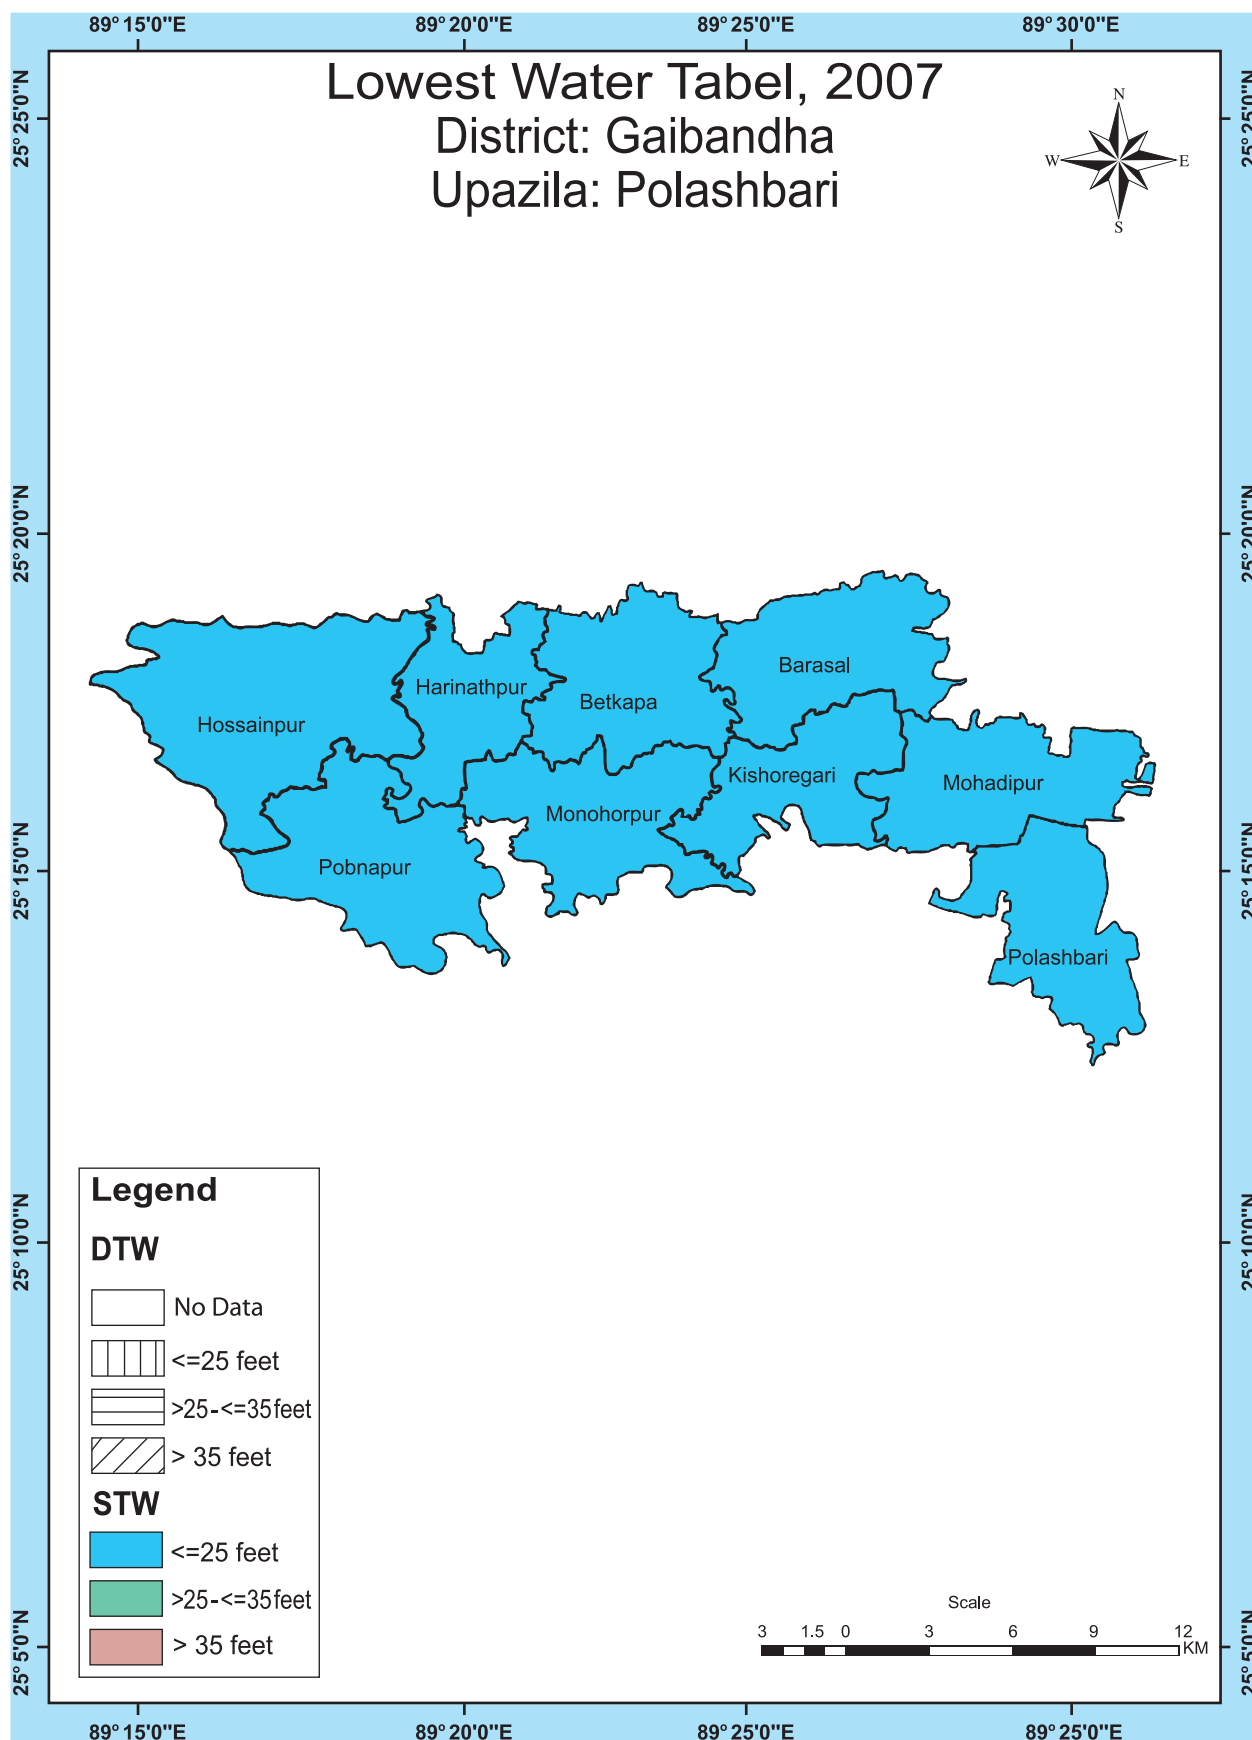



Table
For
Mapping on 'Water Supply Technology' under "GOB-UNICEF Project"


District Name	Upazila Name	Union Name	Water Supply Technology											Remark		
			Lowest Water Table (LWT), 2007 in Feet	% TW As Contamination	Fe Problem (>5 ppm) Yes/No		Cl Problem (>600 ppm) Yes/No		Technology option as per 1993	Average depth of Tube well in Feet		Recommended options on the priority basis: STW: Shallow Tubewell, No.6/T.Dev DTW: Deep Tubewell, No.6/T.Dev DW : Dug Well (Ring well) PSF: Pond Sand Filter ART: Arsenic Removal Technology				
					STW	DTW	STW	DTW		STW	DTW	1	2		3	4
Gaibandha	Gobindagonj	Cochasahar	19	-	27.2	No	-	No	-	ST-SU	65	-	DW/V SST	STW-SU		
Gaibandha	Gobindagonj	Dorbosta	17	-	2.88	No	-	No	-	ST-SU	60	-	STW-SU			
Gaibandha	Gobindagonj	Gobindagonj	19	-	12.01	No	-	No	-	ST-SU	60	-	DW/V SST	STW-SU		
Gaibandha	Gobindagonj	Gumaniganj	24	-	7.48	No	-	No	-	ST-T1	60	-	DW/V SST	STW-SU		
Gaibandha	Gobindagonj	Harirampur	19	-	3.89	No	-	No	-	ST-SU	45	-	STW-SU			
Gaibandha	Gobindagonj	Kamardaha	19	-	4.45	No	-	No	-	ST-SU	50	-	STW-SU			
Gaibandha	Gobindagonj	Kamdia	28	-	0.16	No	-	No	-	ST-T1	60	-	STW-TDev			
Gaibandha	Gobindagonj	Katabari	25	-	0.72	No	-	No	-	ST-T1	55	-	STW-TDev			
Gaibandha	Gobindagonj	Mohimagonj	17	-	1.93	No	-	No	-	ST-SU	50	-	STW-SU			
Gaibandha	Gobindagonj	Nakai	19	-	24.01	No	-	No	-	ST-SU	50	-	DW/V SST	STW-SU		

Table
For
Mapping on 'Water Supply Technology' under "GOB-UNICEF Project"

District Name	Upazila Name	Union Name	Water Supply Technology												Remark			
			Lowest Water Table (LWT), 2007 in Feet	% TW As Contamination	Fe Problem (>5 ppm) Yes/No	Cl Problem (>600 ppm) Yes/No	Technology option as per 1993	Average depth of Tube well in Feet		Recommended options on the priority basis:								
								STW	DTW	STW	DTW	STW	DTW	1		2	3	4
Gaibandha	Gobindagonj	Rajahar	25	-	0.48	No	-	No	-	ST-T1	45	-	STW-TDev					
Gaibandha	Gobindagonj	Rakhalburuj	20	-	13.44	No	-	No	-	ST-SU	65	-	DW/VSST	STW-SU				
Gaibandha	Gobindagonj	Salmara	19	-	1.78	No	-	No	-	ST-SU	50	-	STW-SU					
Gaibandha	Gobindagonj	Shakahar	28	-	0.3	No	-	No	-	ST-T1	45	-	STW-TDev					
Gaibandha	Gobindagonj	Shapmara	25	-	0.62	No	-	No	-	ST-T1	45	-	STW-TDev					
Gaibandha	Gobindagonj	Shibpur	19	-	21.55	No	-	No	-	ST-SU	50	-	DW/VSST	STW-SU				
Gaibandha	Gobindagonj	Taluk Kanupur	20	-	12.78	No	-	No	-	ST-SU	50	-	DW/VSST	STW-SU				

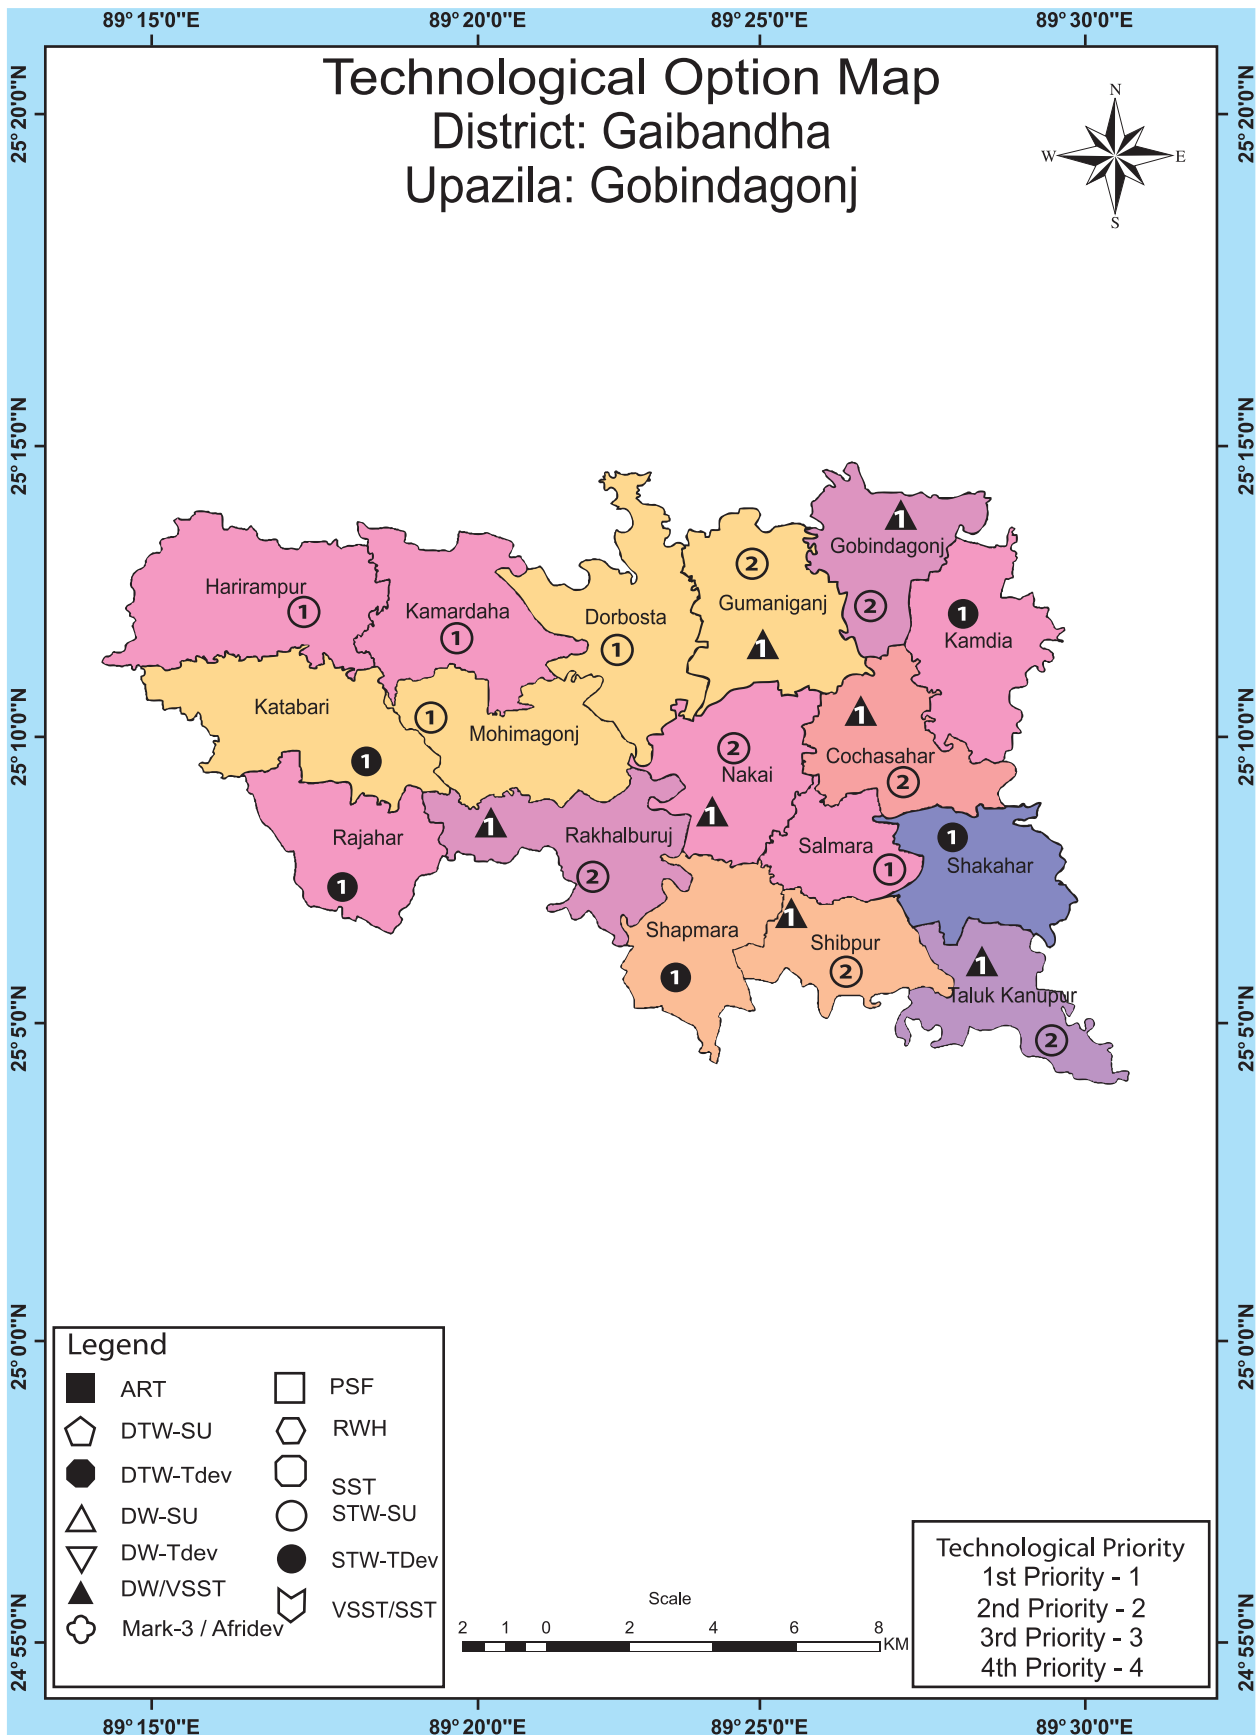

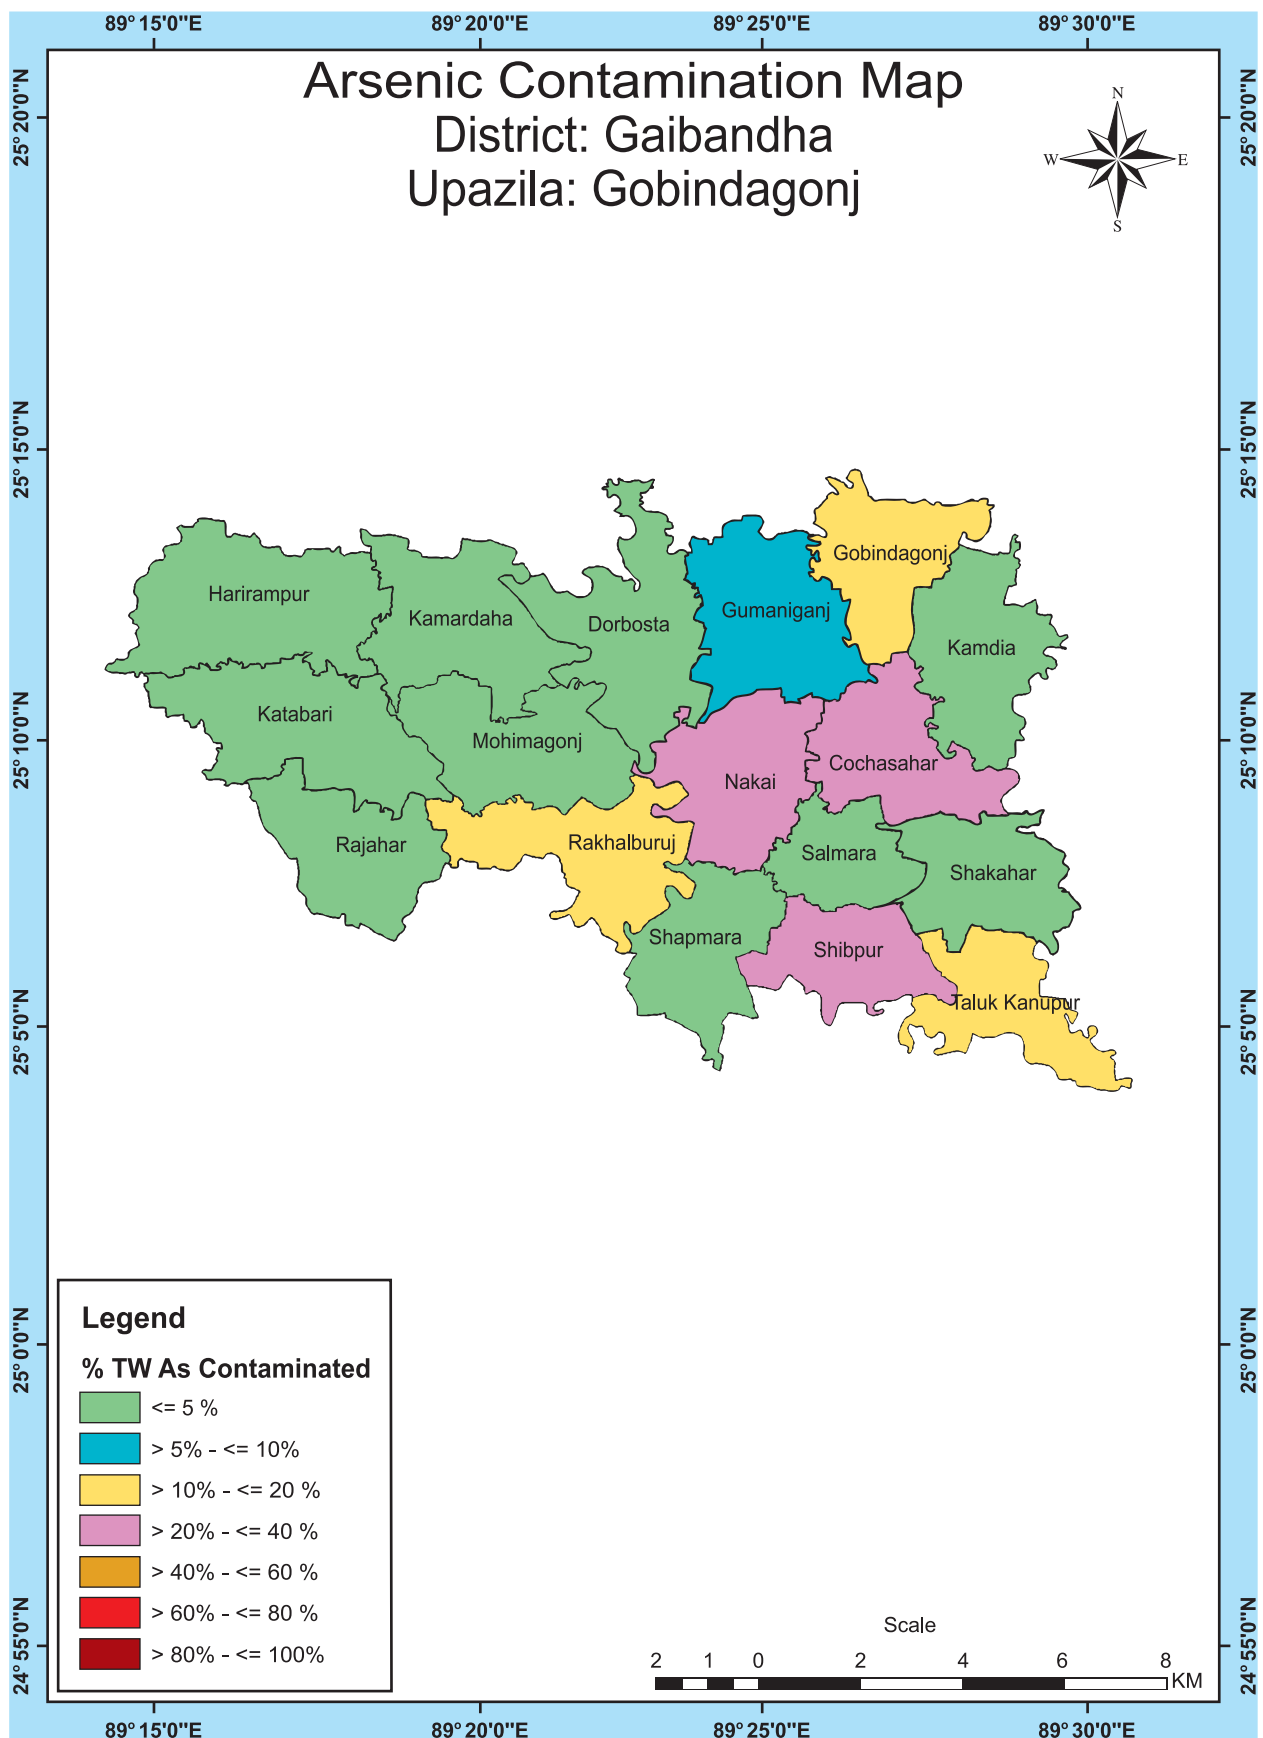

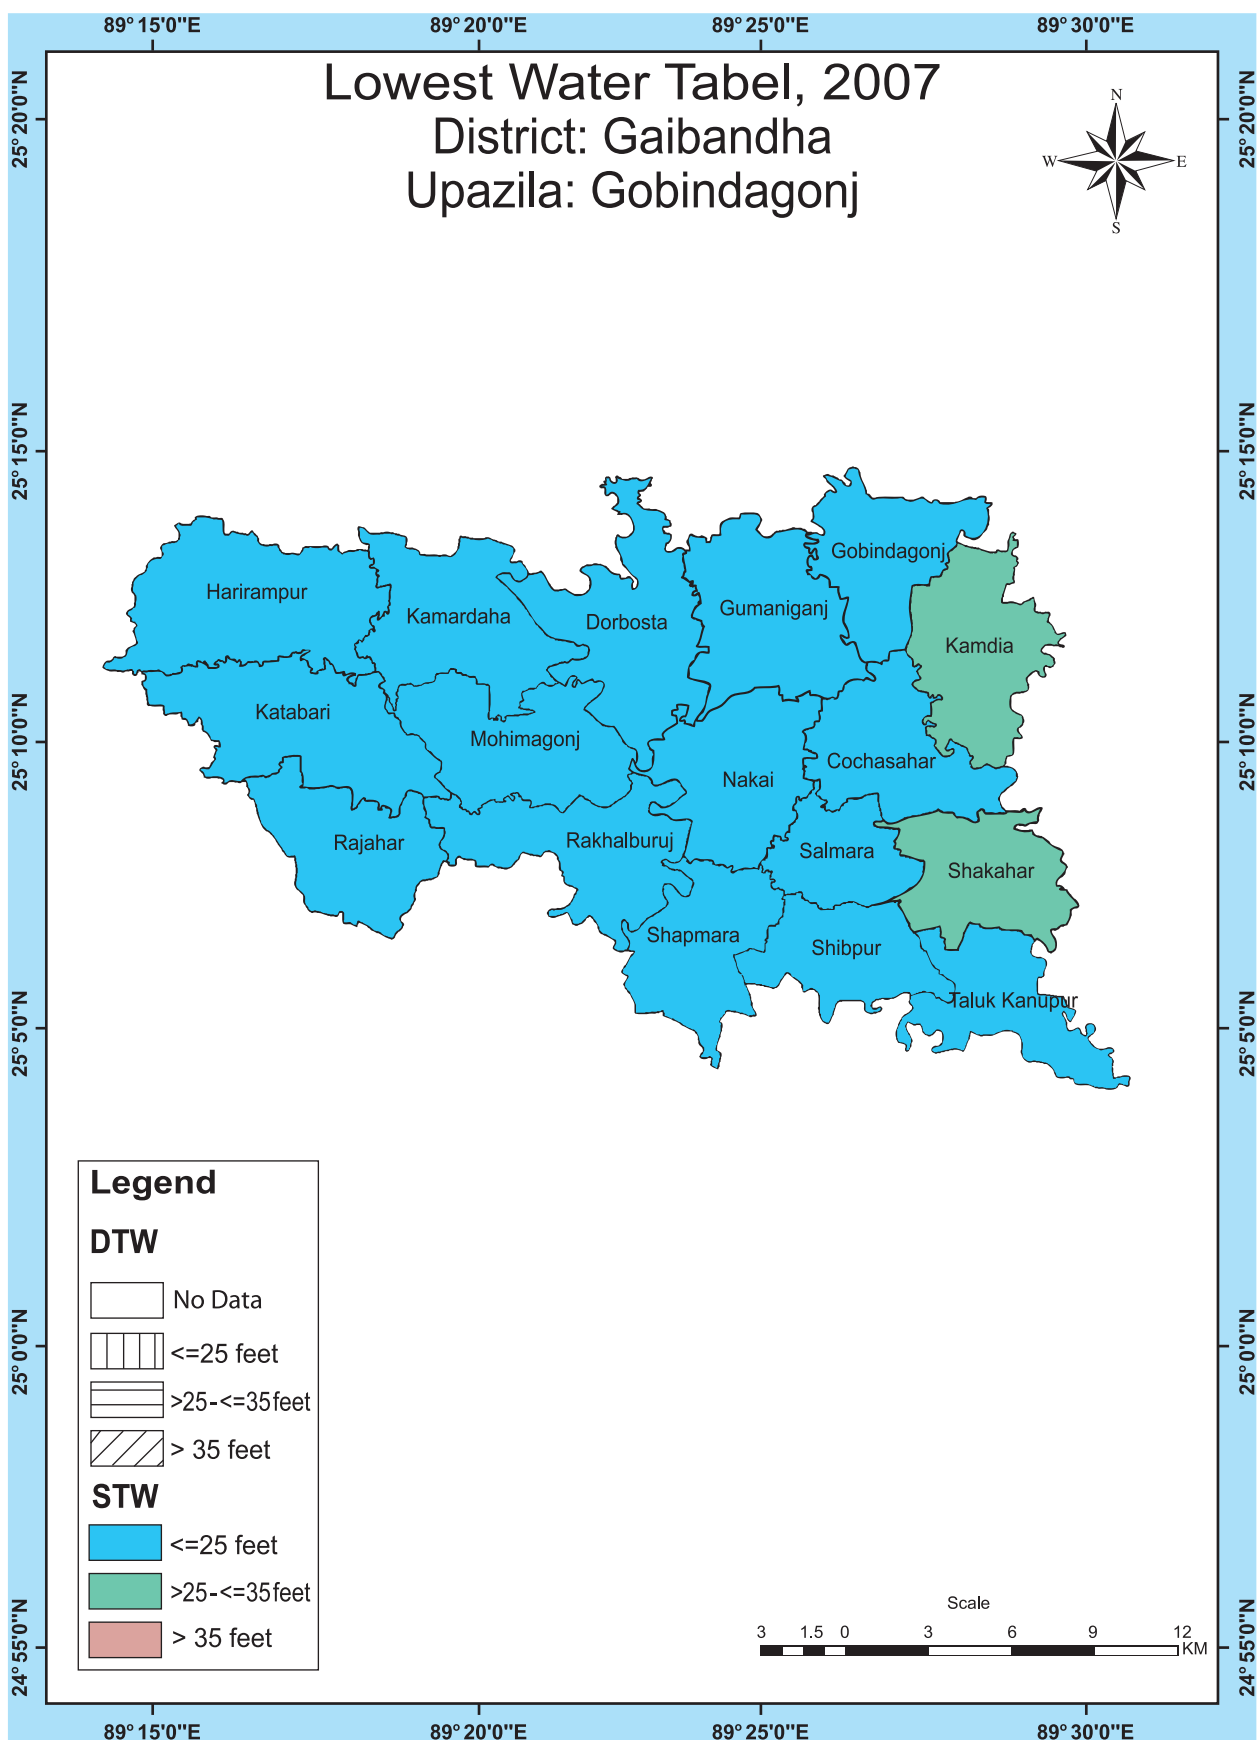


District: Panchagar

Upazila: Sadar
Debiganj
Tetulia

**Table
For**

Mapping on 'Water Supply Technology' under "GOB-UNICEF Project"

District Name	Upazila Name	Union Name	Water Supply Technology										Remark			
			Lowest Water Table (LWT), 2007 in Feet	% TW As Contamination	Fe Problem (>5 ppm) Yes/No	Cl Problem (>600 ppm) Yes/No		Techno logy option as per 1993	Average depth of Tube well in Feet	Recommended options on the priority basis:						
										STW: Shallow Tubewell, No.6/T.Dev DTW: Deep Tubewell, No.6/T.Dev DW : Dug Well (Ring well) PSF: Pond Sand Filter ART: Arsenic Removal Technology						
										STW	DTW	STW		DTW	1	2
Panchagarh	Panchagarh sadar	Chaklahat	16	-	N/D	No	-	No	-	ST-SU	100	-	STW-SU	DW-SU		
Panchagarh	Panchagarh sadar	Dhakkamar	19	-	N/D	No	-	No	-	ST-SU	150	-	STW-SU	DW-SU		
Panchagarh	Panchagarh sadar	Gorinabari	19	-	N/D	No	-	No	-	ST-SU	150	-	STW-SU	DW-SU		
Panchagarh	Panchagarh sadar	Hafizabad	16	-	N/D	No	-	No	-	ST-SU	100	-	STW-SU	DW-SU		
Panchagarh	Panchagarh sadar	Haribhasa	16	-	N/D	No	-	No	-	ST-SU	100	-	STW-SU	DW-SU		
Panchagarh	Panchagarh sadar	Kamatkazaldighi	14	-	N/D	No	-	No	-	ST-SU	100	-	STW-SU	DW-SU		
Panchagarh	Panchagarh sadar	Magura	19	-	N/D	No	-	No	-	ST-SU	150	-	STW-SU	DW-SU		
Panchagarh	Panchagarh sadar	Panchagarh	15	-	N/D	No	-	No	-	ST-SU	100	-	STW-SU	DW-SU		
Panchagarh	Panchagarh sadar	Satmera	14	-	N/D	No	-	No	-	ST-SU	100	-	STW-SU	DW-SU		
Panchagarh	Panchagarh sadar	Umarkhana	22	-	N/D	No	-	No	-	ST-SU	100	-	STW-SU	DW-SU		

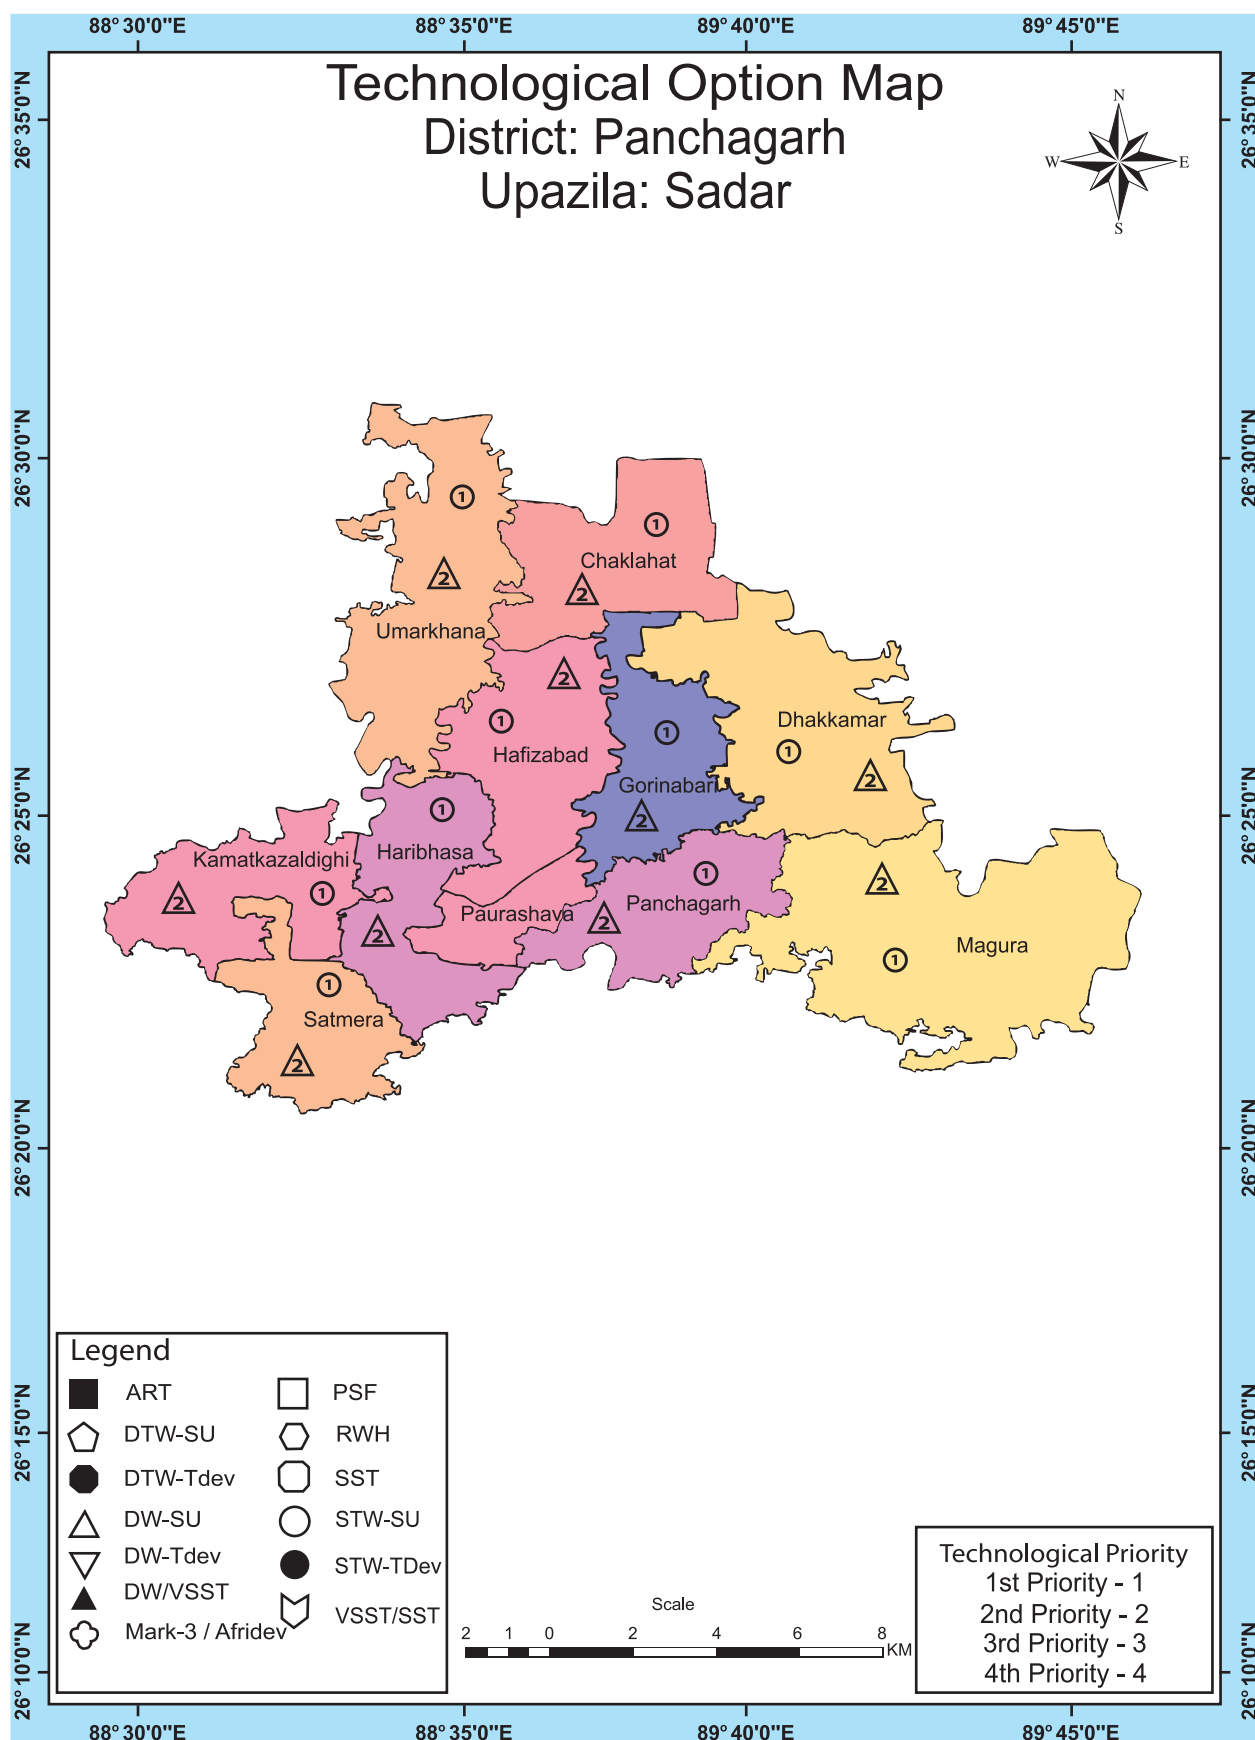

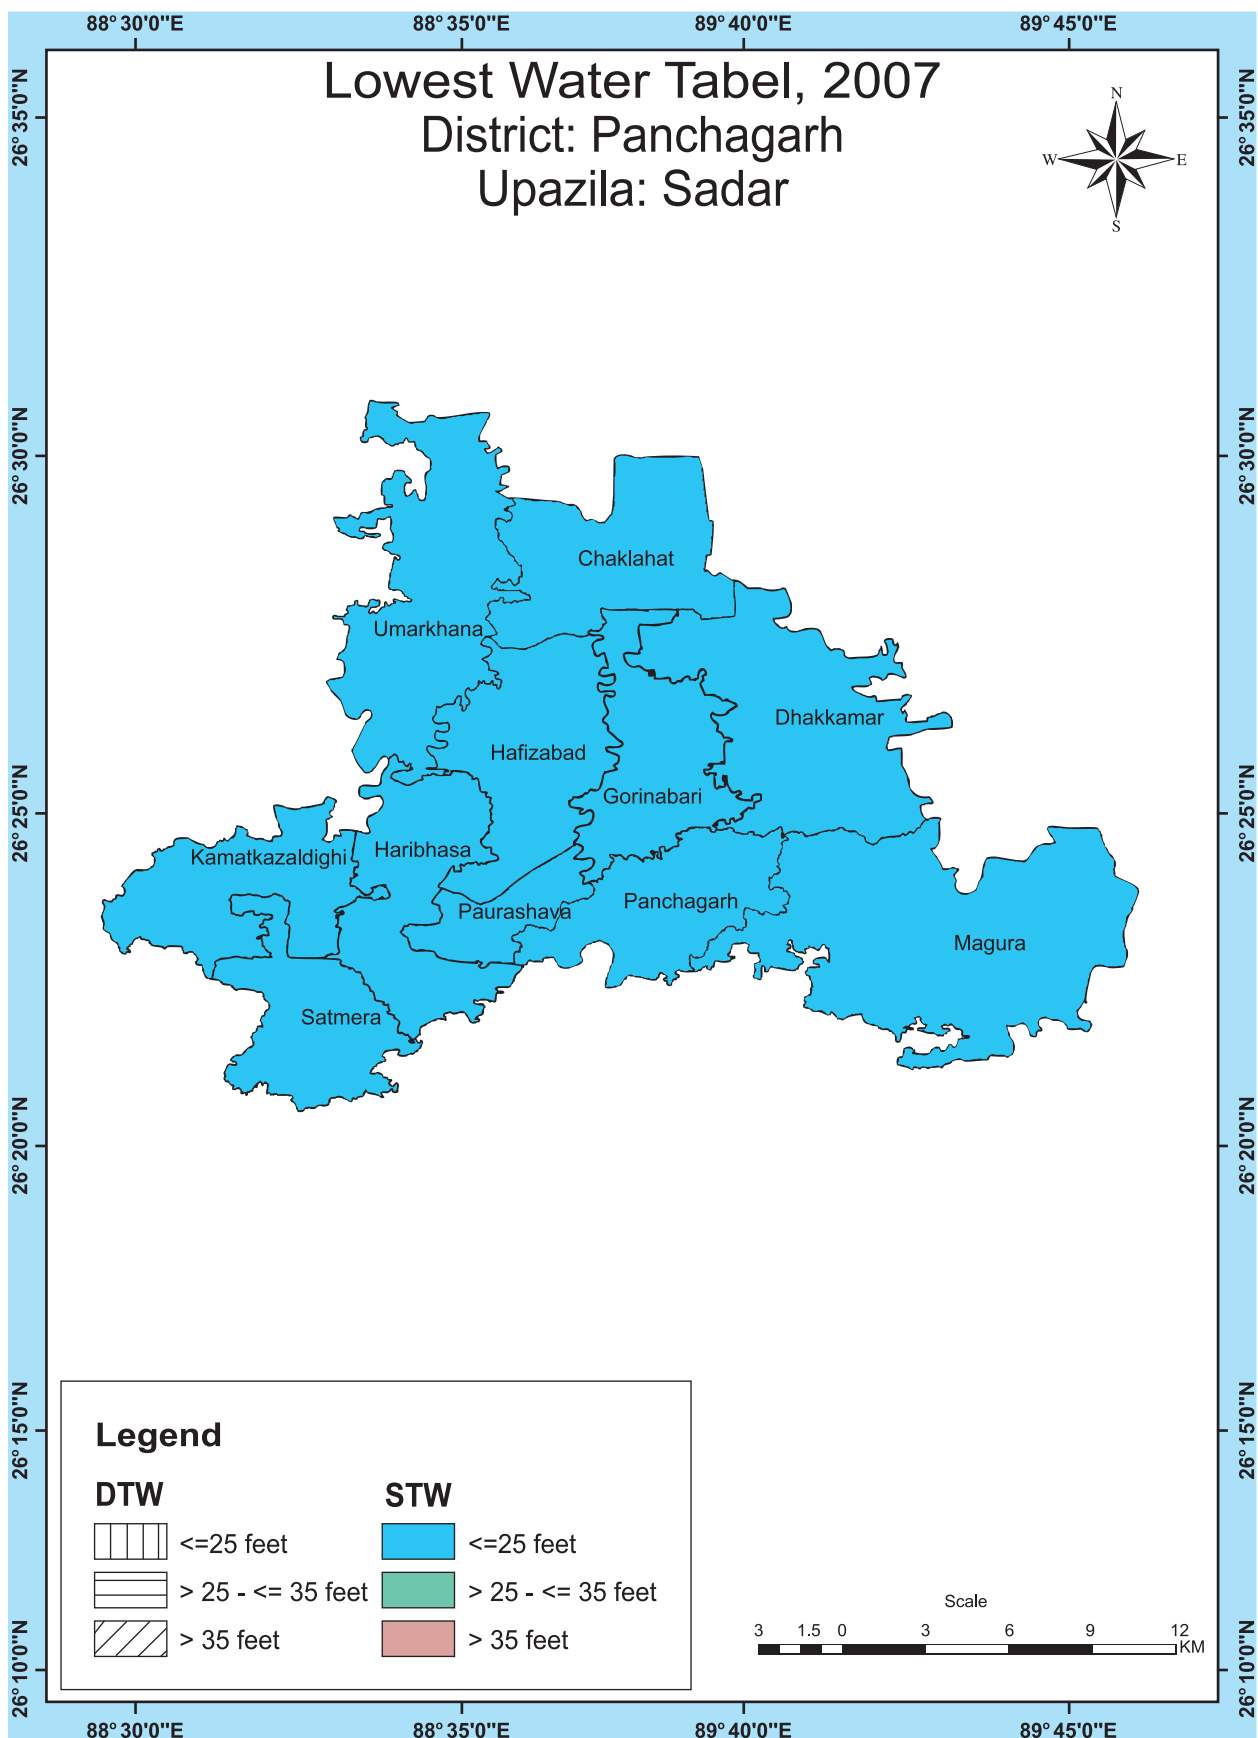
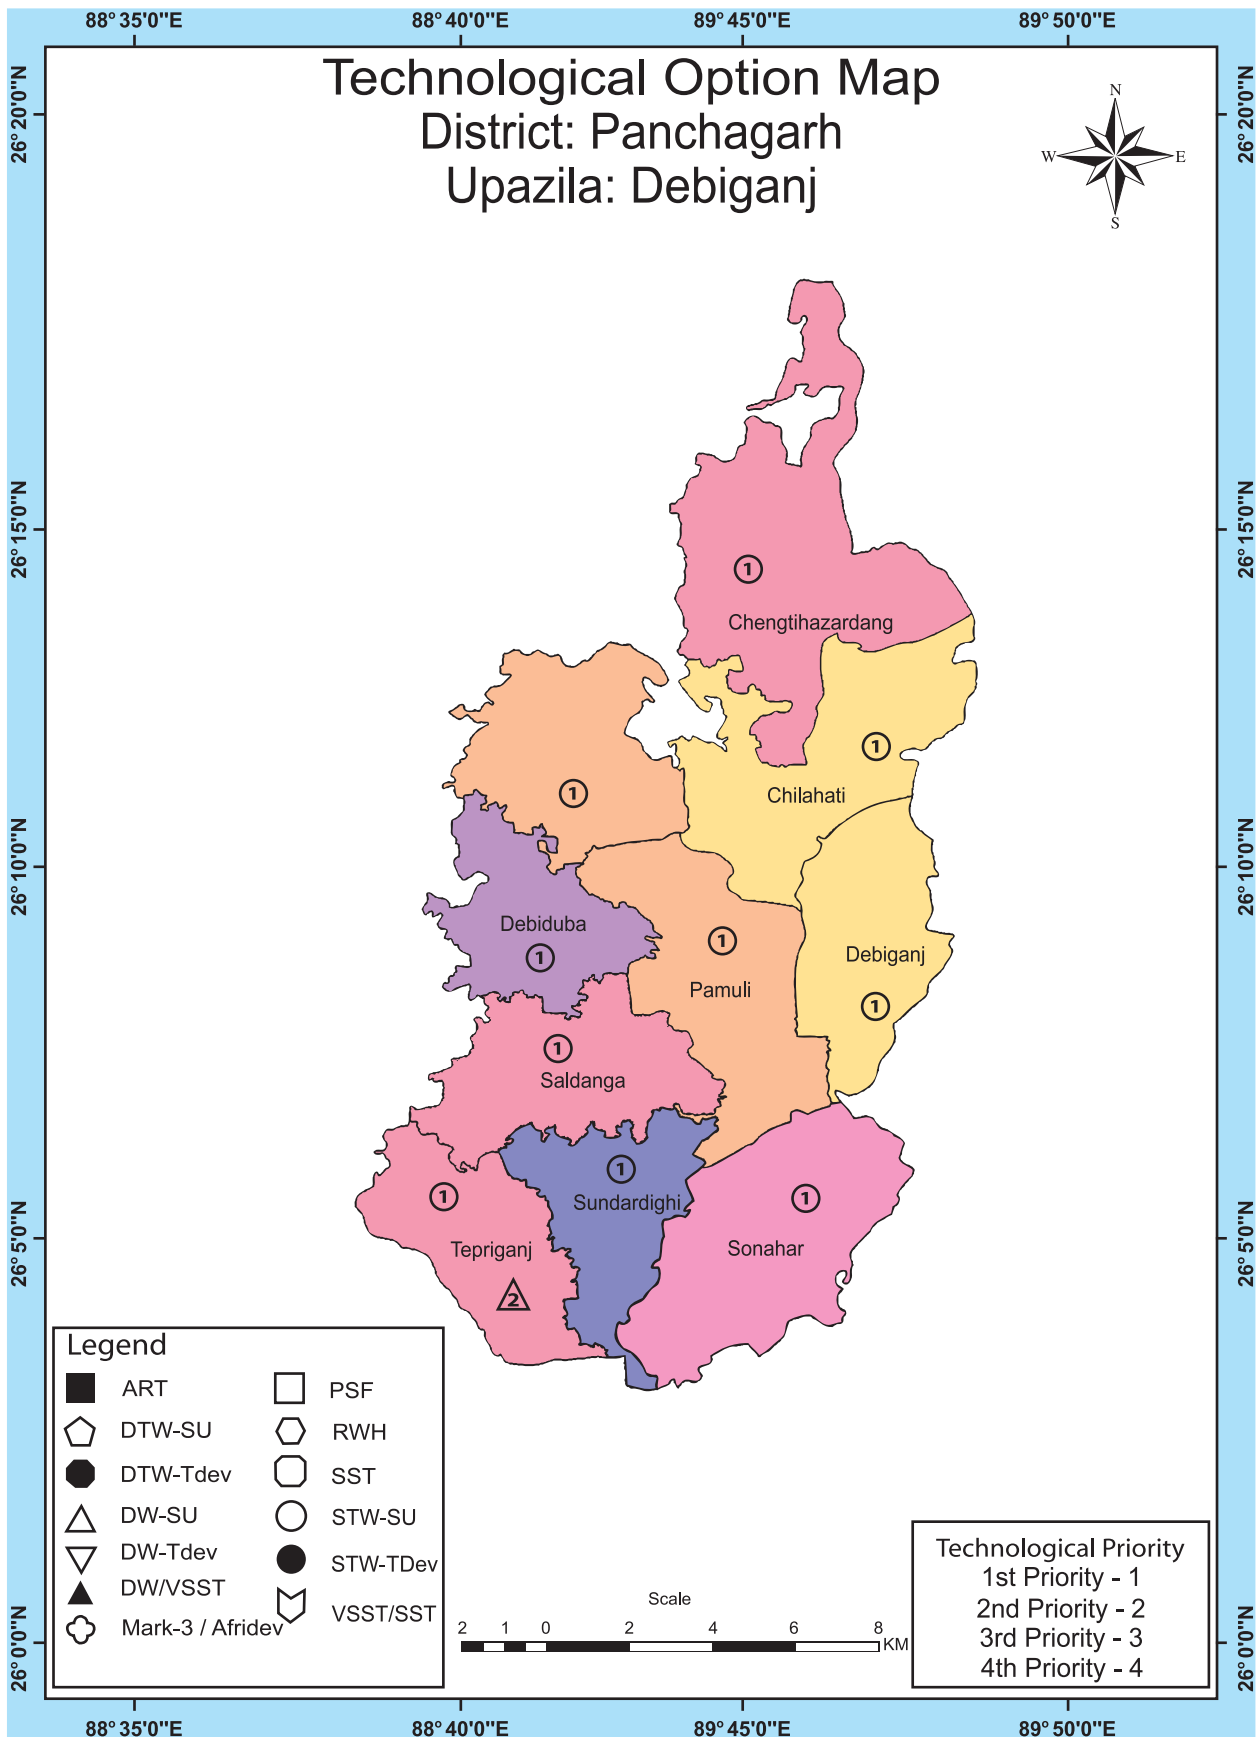


Table
For
Mapping on 'Water Supply Technology' under "GOB-UNICEF Project"

District Name	Upazila Name	Union Name	Water Supply Technology												Remark	
			Lowest Water Table (LWT), 2007 in Feet	% TW As Contamination	Fe Problem (>5 ppm) Yes/No	Cl Problem (>600 ppm) Yes/No	Technology option as per 1993	Average depth of Tube well in Feet	Recommended options on the priority basis:							
			STW	DTW				STW	DTW	STW	DTW	1	2	3		4
Panchagarh	Debiganj	Chengti	22	-	N/D	No	-	No	-	ST-SU	60	-	STW-SU	-		Depth of
Panchagarh	Debiganj	Chilahati	21	-	N/D	No	-	No	-	ST-SU	85	-	STW-SU	-		STW to be
Panchagarh	Debiganj	Dandapal	18	-	N/D	No	-	No	-	ST-SU	60	-	STW-SU	-		refixed
Panchagarh	Debiganj	Debiduba	21	-	N/D	No	-	No	-	ST-SU	60	-	STW-SU	-		based on
Panchagarh	Debiganj	Debiganj	21	-	N/D	No	-	No	-	ST-SU	60	-	STW-SU	-		Test well
Panchagarh	Debiganj	Pamuli	19	-	N/D	No	-	No	-	ST-SU	60	-	STW-SU	-		result in
Panchagarh	Debiganj	Saldanga	21	-	N/D	No	-	No	-	ST-SU	60	-	STW-SU	-		Iron (Fe)
Panchagarh	Debiganj	Sonahar	21	-	N/D	No	-	No	-	ST-SU	60	-	STW-SU	-		problem
Panchagarh	Debiganj	Sundardighi	18	-	N/D	No	-	No	-	ST-SU	60	-	STW-SU	-		areas.
Panchagarh	Debiganj	Tepriganj	21	-	N/D	No	-	No	-	ST-SU	60	-	STW-SU	DW-SU		





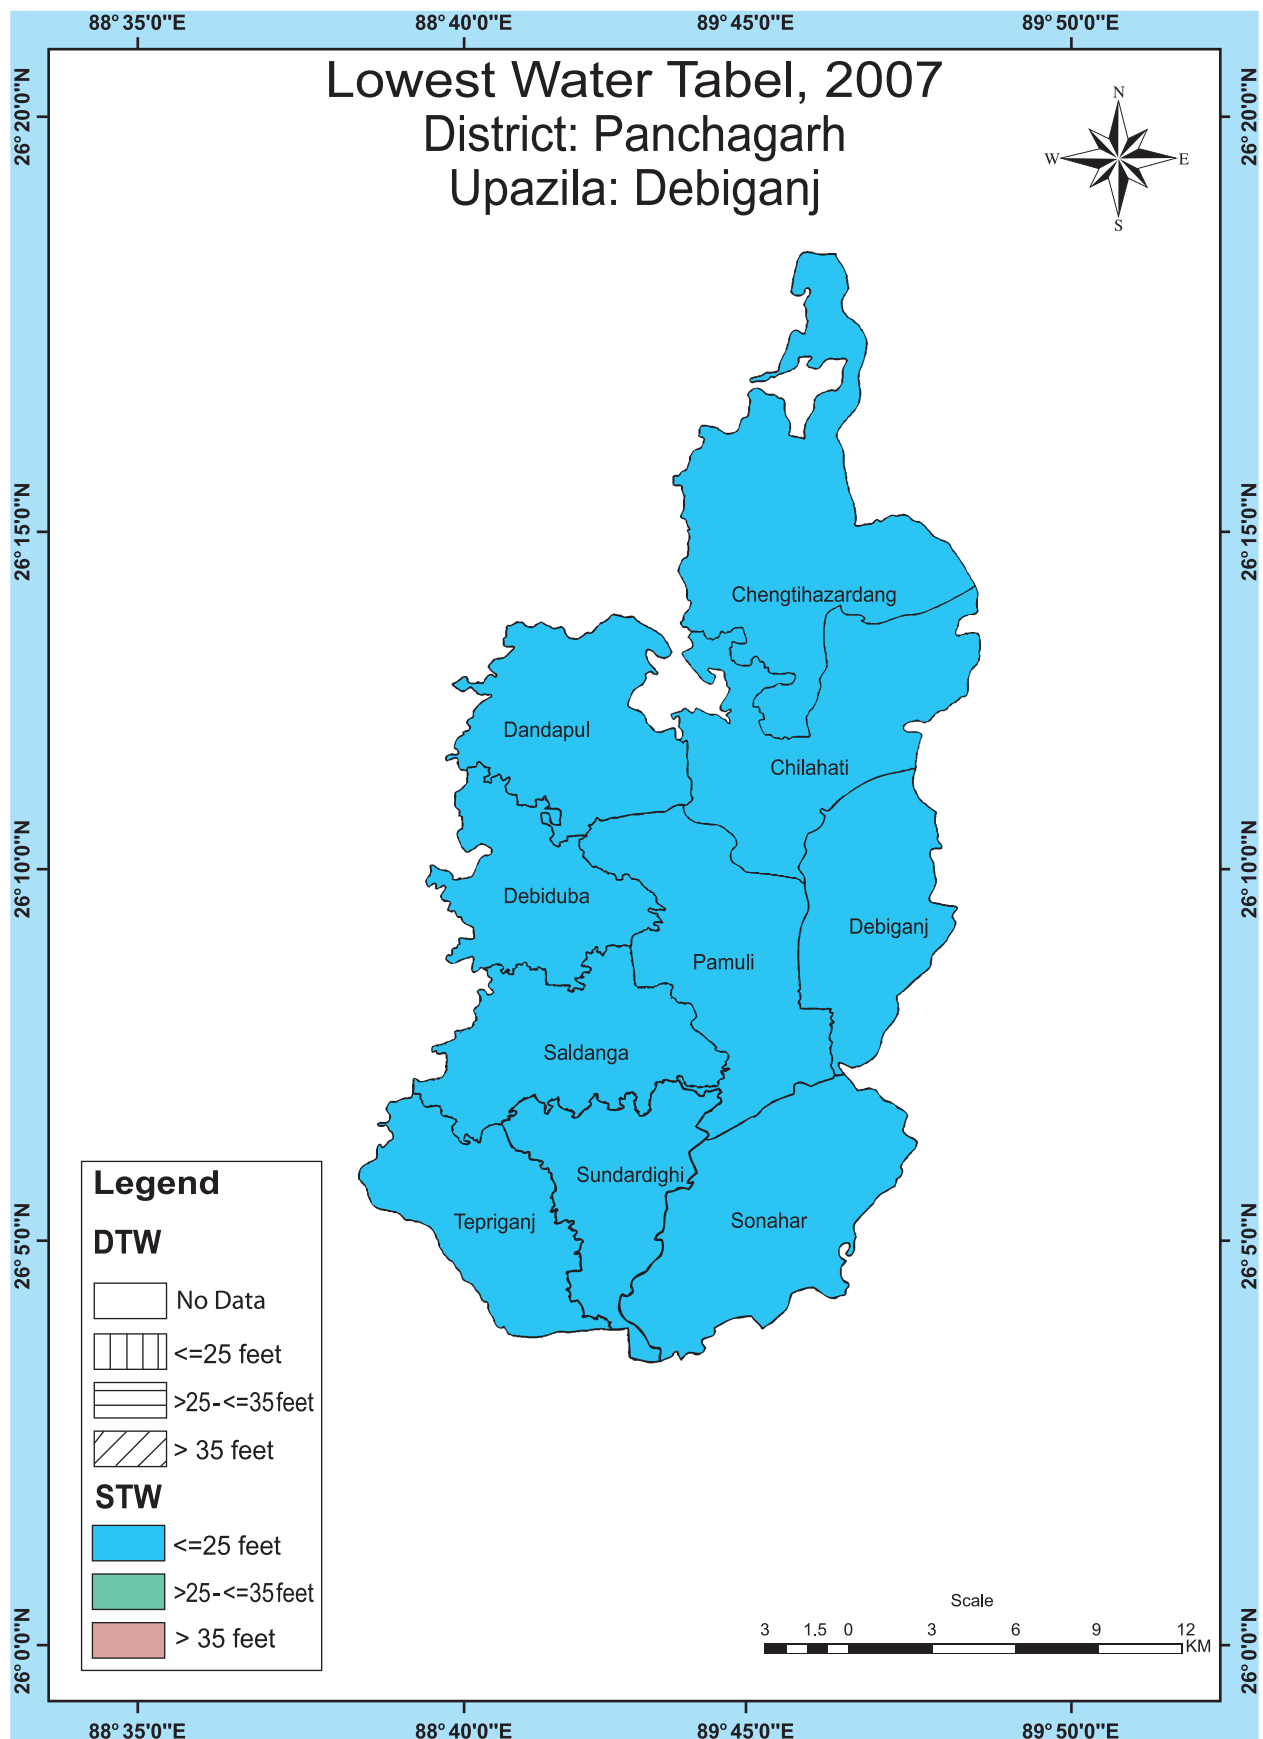


Table
For
Mapping on 'Water Supply Technology' under "GOB-UNICEF Project"

District Name	Upazila Name	Union Name	Water Supply Technology										Remark			
			Lowest Water Table (LWT), 2007 in Feet	% TW As Contamination	Fe Problem (>5 ppm) Yes/No		CI Problem (>600 ppm) Yes/No		Technology option as per 1993	Average depth of Tube well in Feet	Recommended options on the priority basis:					
					STW	DTW	STW	DTW			1	2		3	4	
Panchagarh	Tetulia	Banglabandha	15	-	N/D	No	-	No	-	ST-SU	60	-	STW-SU	DW-SU		
Panchagarh	Tetulia	Bhojanpur	14	-	N/D	No	-	No	-	ST-SU	60	-	STW-SU	DW-SU		
Panchagarh	Tetulia	Buraburi	13	-	N/D	No	-	No	-	ST-SU	60	-	STW-SU	DW-SU		
Panchagarh	Tetulia	Debnagar	12	-	N/D	No	-	No	-	ST-SU	60	-	STW-SU	DW-SU		
Panchagarh	Tetulia	Salbahan	18	-	N/D	No	-	No	-	ST-SU	60	-	STW-SU	DW-SU		
Panchagarh	Tetulia	Tetulia	18	-	N/D	No	-	No	-	ST-SU	60	-	STW-SU	DW-SU		
Panchagarh	Tetulia	Tirnihat	16	-	N/D	No	-	No	-	ST-SU	60	-	STW-SU	DW-SU		

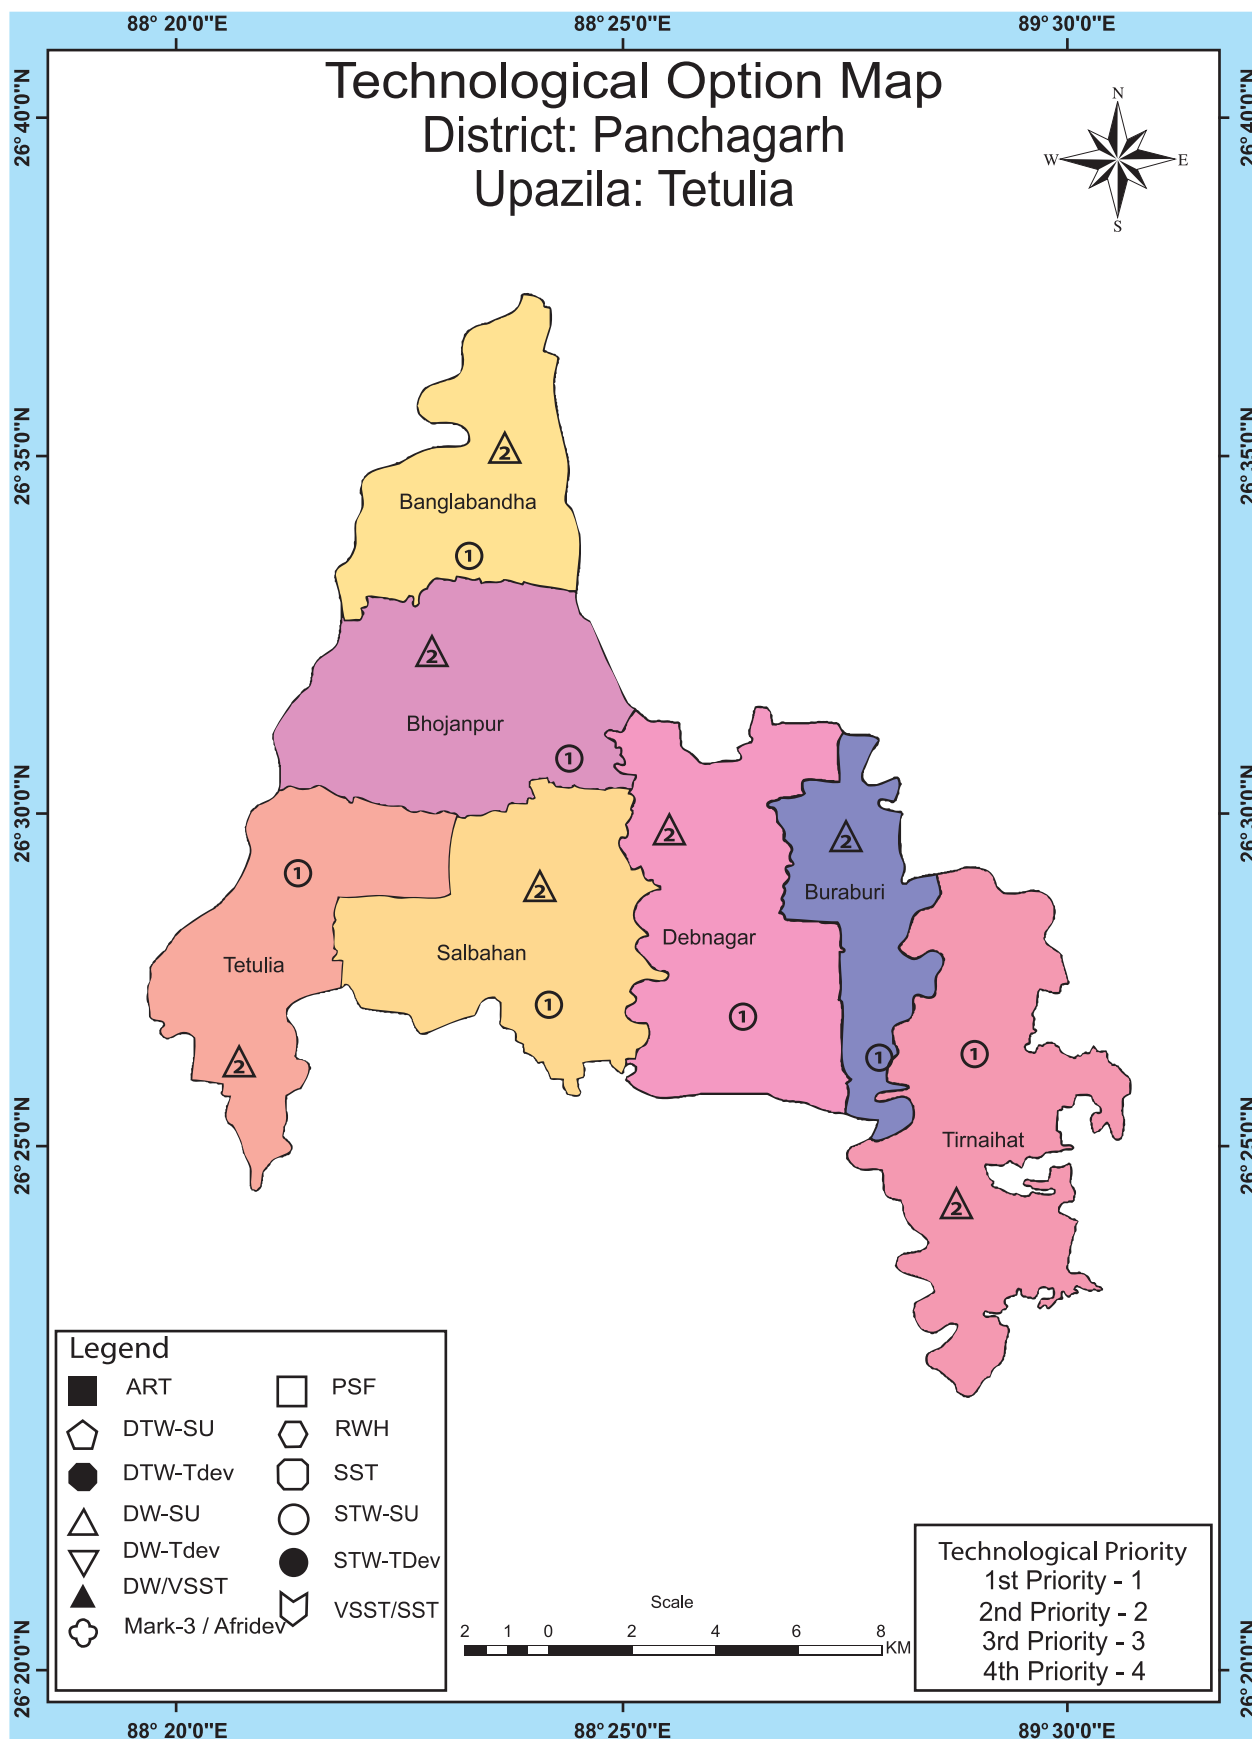

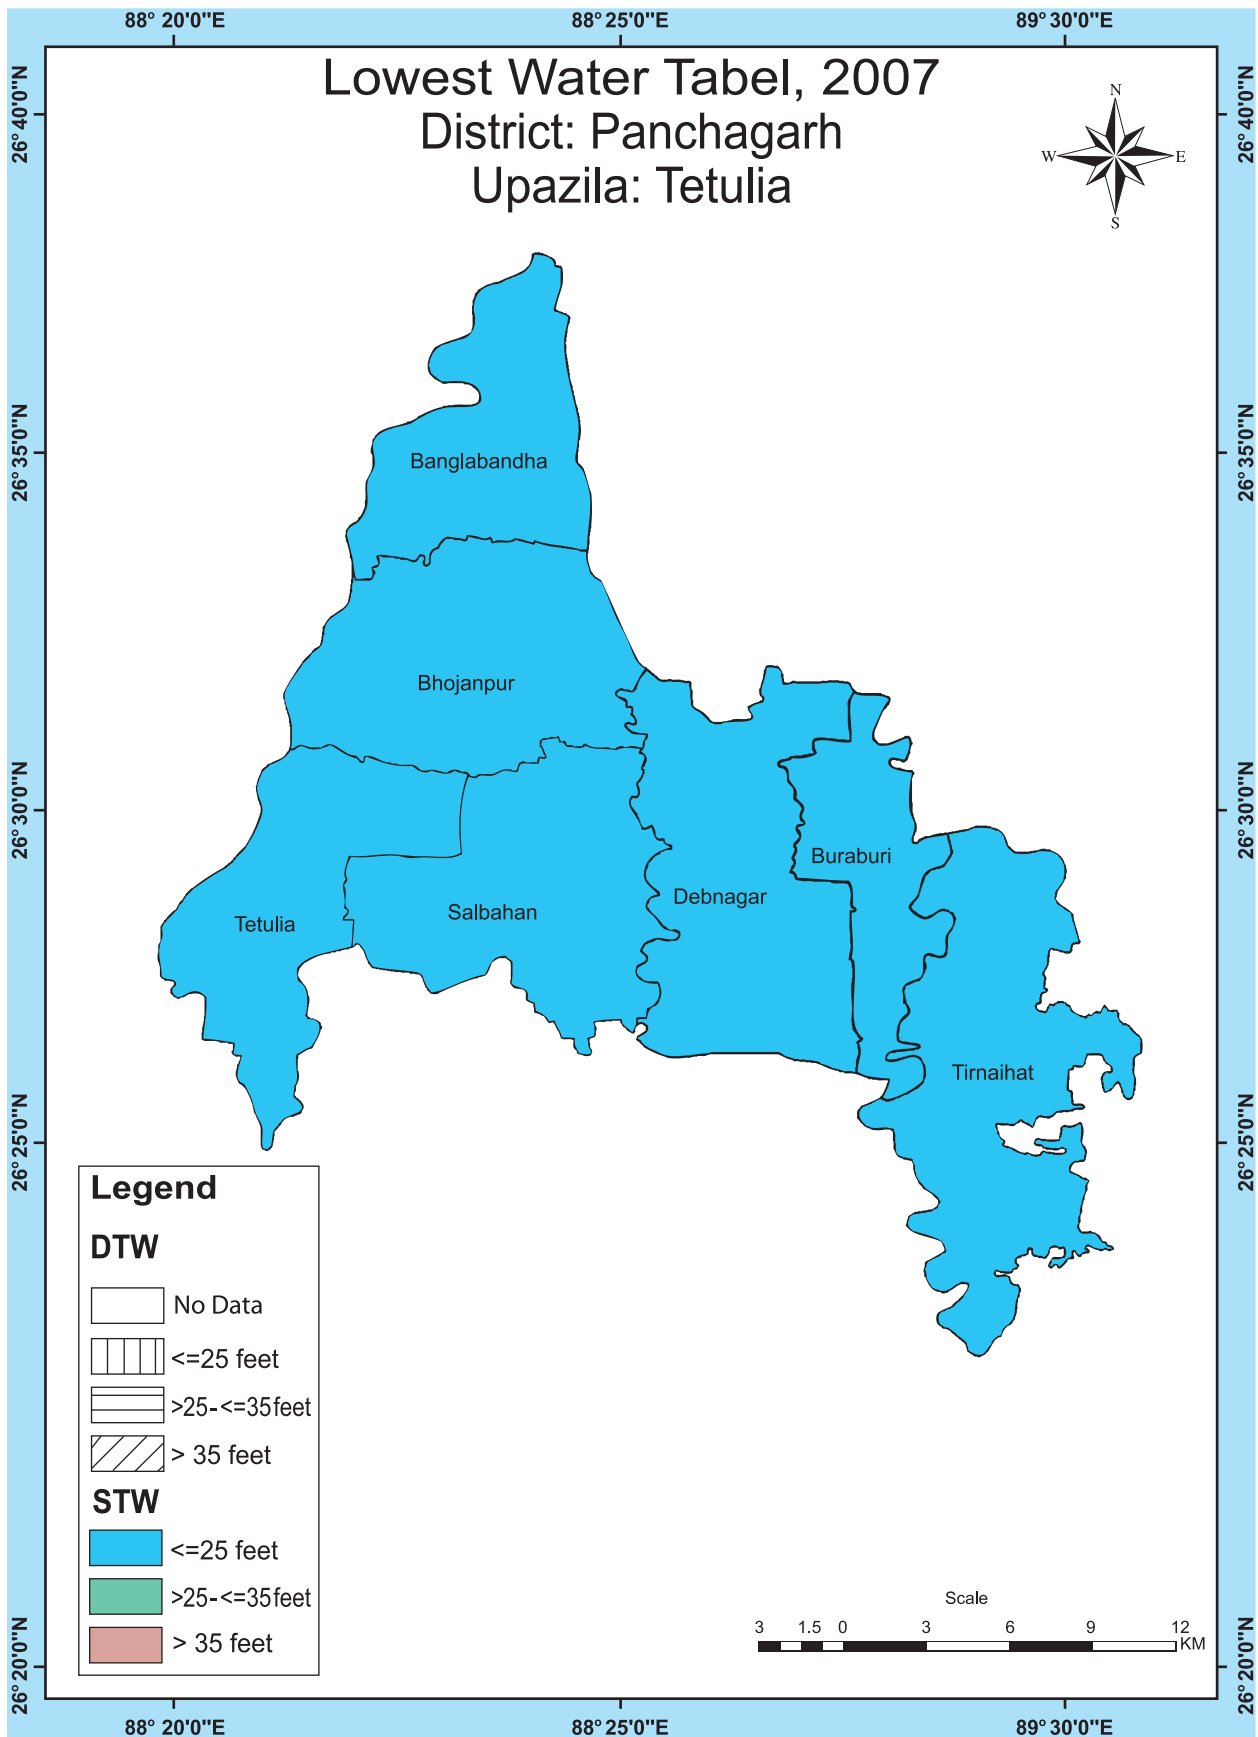



District: Rangpur

Upazila: Sadar
Badarganj
Taraganj
Gangchhara

Table
For
Mapping on 'Water Supply Technology' under "GOB-UNICEF Project"

District Name	Upazila Name	Union Name	Water Supply Technology										Remark			
			Lowest Water Table (LWT), 2007 in Feet	% TW As Contami nation	Fe Problem (>5 ppm) Yes/No	CI Problem (>600 ppm) Yes/No	Techno logy option as per 1993	Average depth of Tube well in Feet	Recommended options on the priority basis: STW: Shallow Tubewell, No.6/T.Dev DTW: Deep Tubewell, No.6/T.Dev DW : Dug Well (Ring well) PSF: Pond Sand Filter ART: Arsenic Removal Technology							
									STW	DTW	STW	DTW		STW	DTW	1
Rangpur	Rangpur sadar	Chandanpat	17	-	N/D	No	No	-	No	-	ST-SU	70	-	STW-SU		
Rangpur	Rangpur sadar	Darsona	16	-	N/D	No	No	-	No	-	ST-SU	65	-	STW-SU		
Rangpur	Rangpur sadar	Haridevpur	14	-	N/D	No	No	-	No	-	ST-SU	70	-	STW-SU		
Rangpur	Rangpur sadar	Mominpur	16	-	N/D	No	No	-	No	-	ST-SU	65	-	STW-SU		
Rangpur	Rangpur sadar	Poshura	14	-	N/D	No	No	-	No	-	ST-SU	70	-	STW-SU		
Rangpur	Rangpur sadar	Rajendrapur	17	-	N/D	No	No	-	No	-	ST-SU	65	-	STW-SU		
Rangpur	Rangpur sadar	Sadyapushkarni	16	-	N/D	No	No	-	No	-	ST-SU	80	-	STW-SU		
Rangpur	Rangpur sadar	Satgara	16	-	N/D	No	No	-	No	-	ST-SU	60	-	STW-SU		
Rangpur	Rangpur sadar	Tampat	17	-	N/D	No	No	-	No	-	ST-SU	65	-	STW-SU		
Rangpur	Rangpur sadar	Topodhan	18	-	N/D	No	No	-	No	-	ST-SU	65	-	STW-SU		
Rangpur	Rangpur sadar	Uttam	14	-	N/D	No	No	-	No	-	ST-SU	70	-	STW-SU		

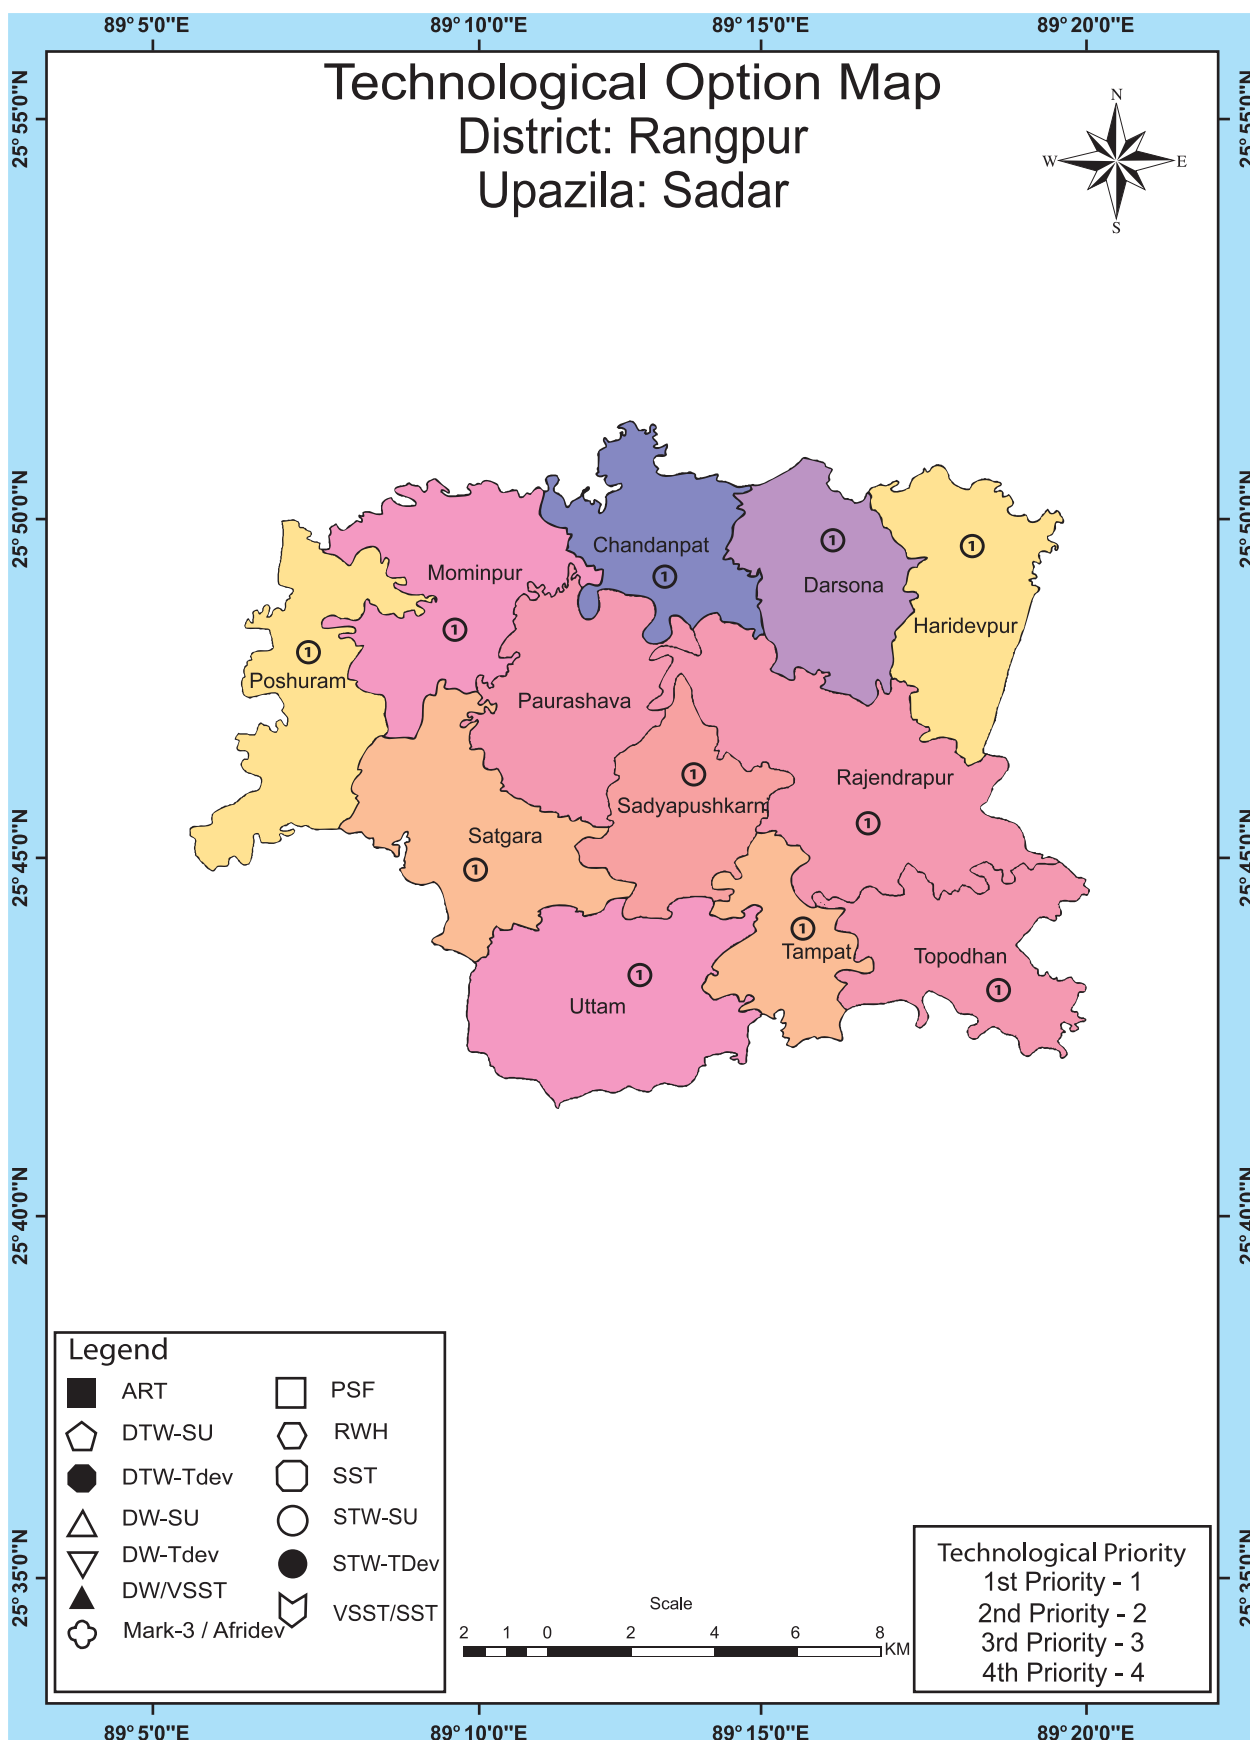


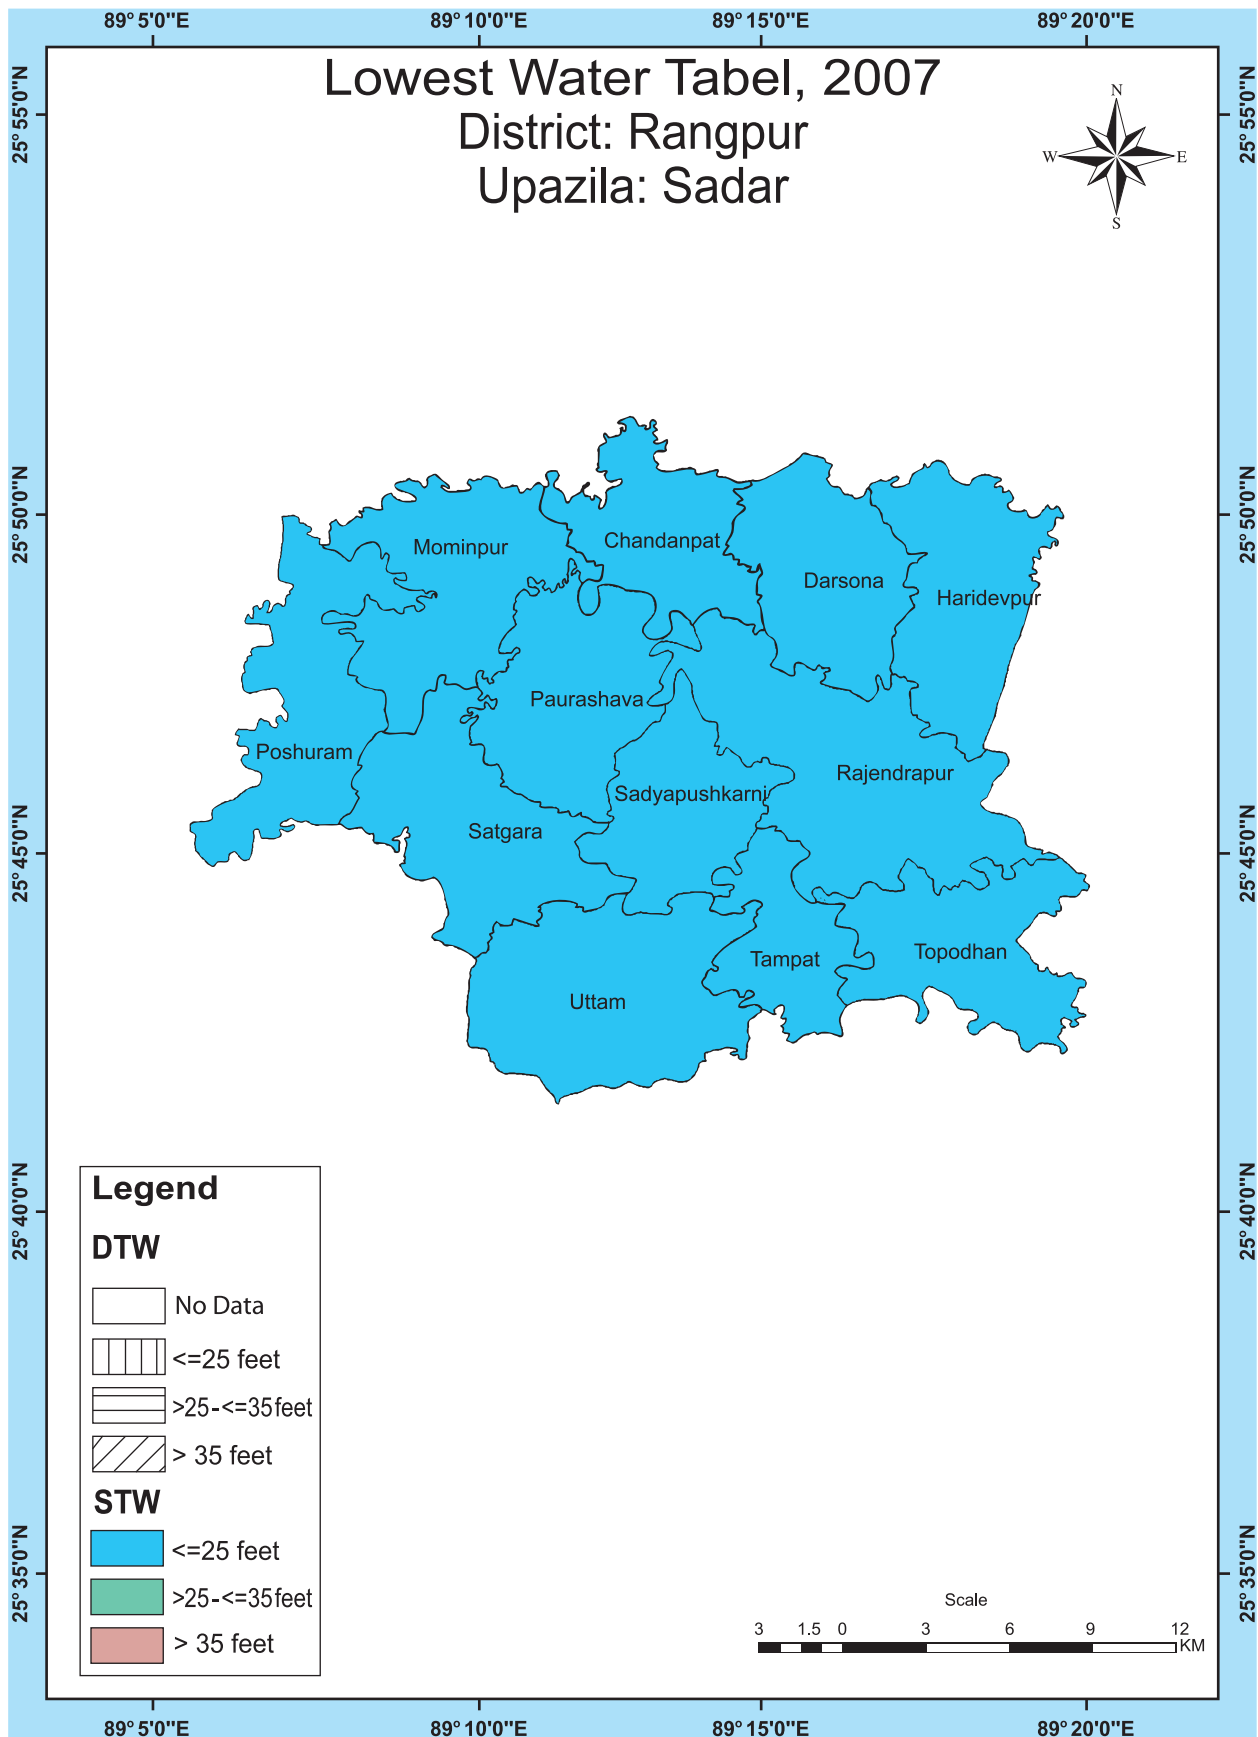

**Table
For**

Mapping on 'Water Supply Technology' under "GOB-UNICEF Project"

District Name	Upazila Name	Union Name	Water Supply Technology										Remark			
			Lowest Water Table (LWT), 2007 in Feet	% TW As Contami nation	Fe Problem (>5 ppm) Yes/No	Ci Problem (>600 ppm) Yes/No		Techno logy option as per 1993	Average depth of Tube well in Feet	Recommended options on the priority basis:						
						STW	DTW			STW	DTW	1		2	3	4
Rangpur	Badarganj	Badarganj	25	-	N/D	No	-	No	-	ST-T1	65	-	STW-TDev	-		
Rangpur	Badarganj	Bisnopor	24	-	N/D	No	-	No	-	ST-T1	65	-	STW-SU	DW-SU		
Rangpur	Badarganj	Damudarpur	24	-	N/D	No	-	No	-	ST-T1	65	-	STW-SU	DW-SU		
Rangpur	Badarganj	Gopalpur	16	-	N/D	No	-	No	-	ST-SU	75	-	STW-SU	DW-SU		
Rangpur	Badarganj	Gopinathpur	25	-	N/D	No	-	No	-	ST-T1	65	-	STW-TDev	-		
Rangpur	Badarganj	Kutubpur	16	-	N/D	No	-	No	-	ST-SU	70	-	STW-SU	DW-SU		
Rangpur	Badarganj	Lohanipara	16	-	N/D	No	-	No	-	ST-SU	70	-	STW-SU	DW-SU		
Rangpur	Badarganj	Kalupara	16	-	N/D	No	-	No	-	N/D	N/D	-	STW-SU	DW-SU		
Rangpur	Badarganj	Modhupur	24	-	N/D	No	-	No	-	ST-T1	60	-	STW-SU	DW-SU		
Rangpur	Badarganj	Radhanagar	26	-	N/D	No	-	No	-	ST-T1	65	-	STW-TDev			
Rangpur	Badarganj	Ramnathpur	25	-	N/D	No	-	No	-	ST-T1	70	-	STW-TDev			

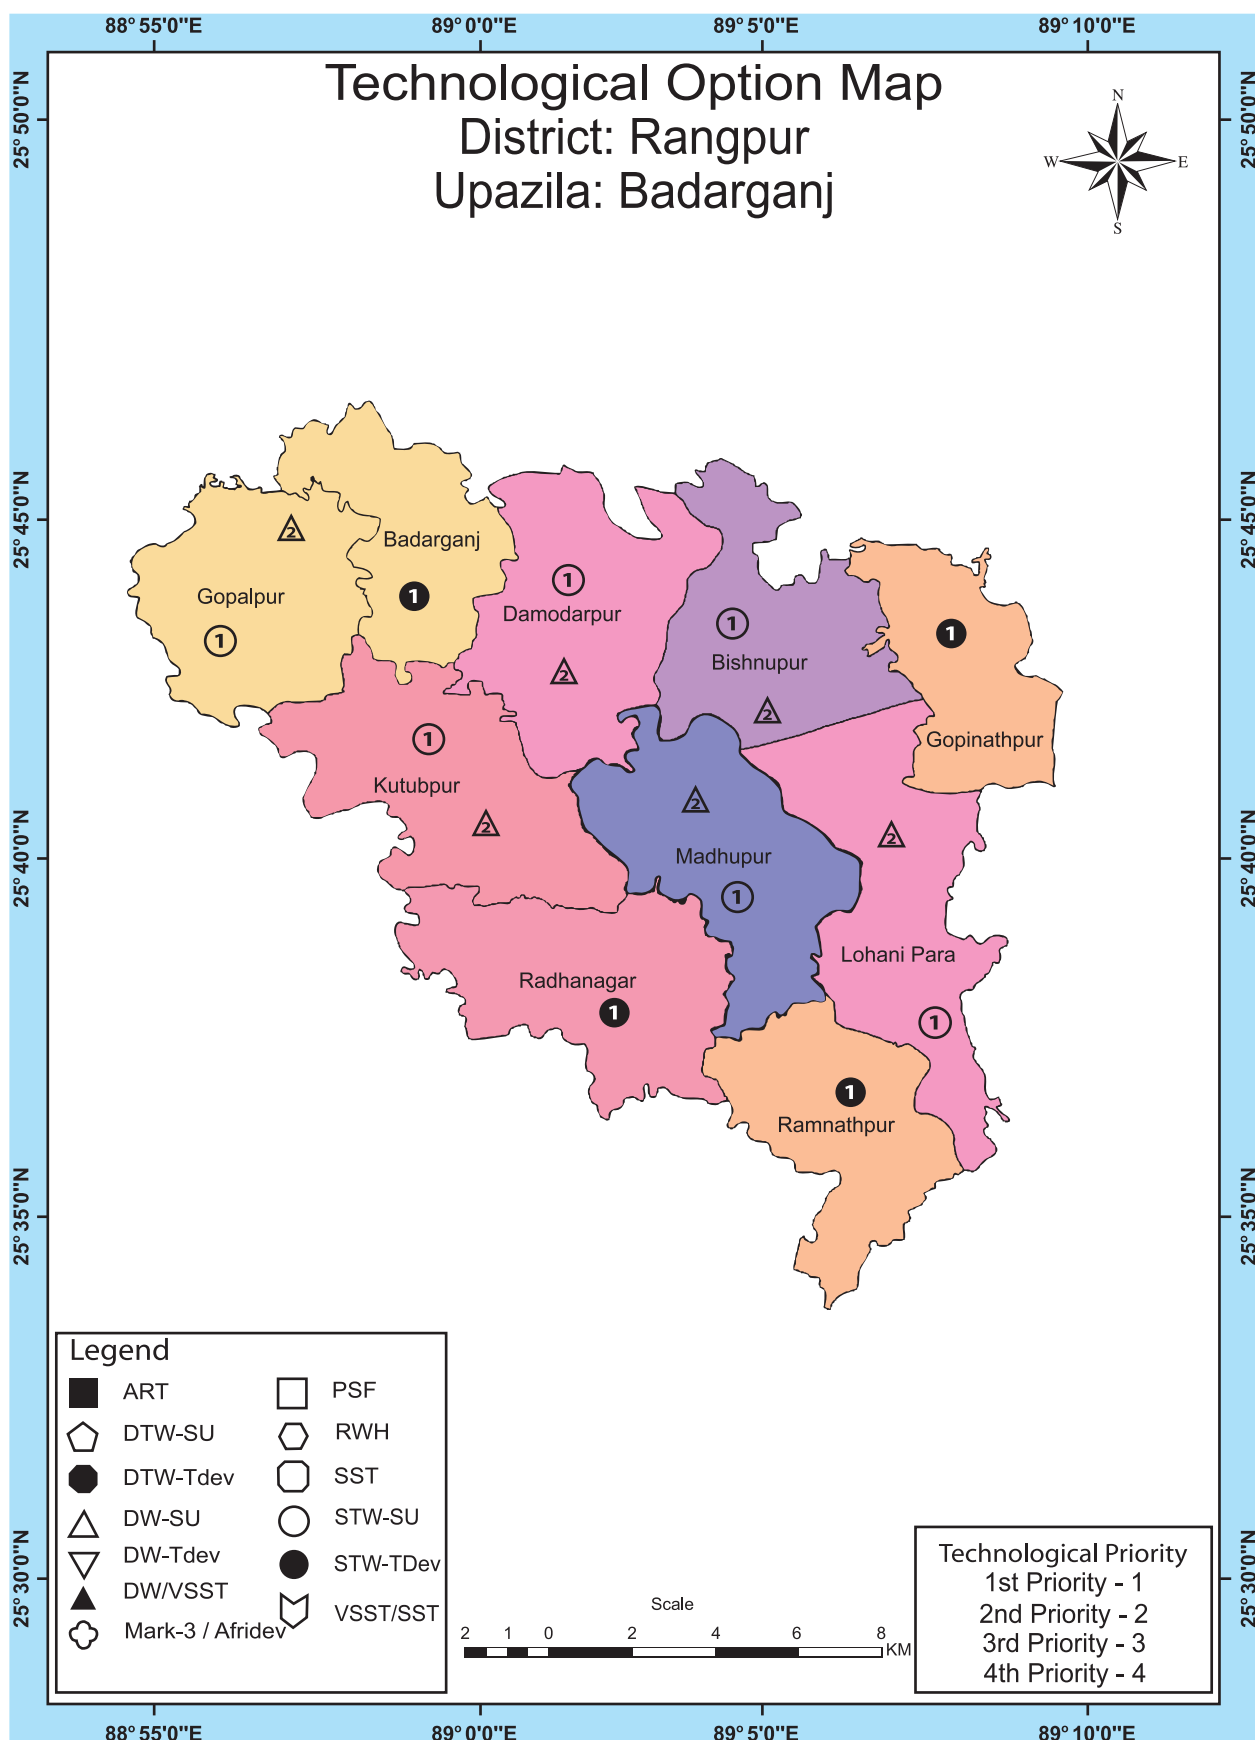

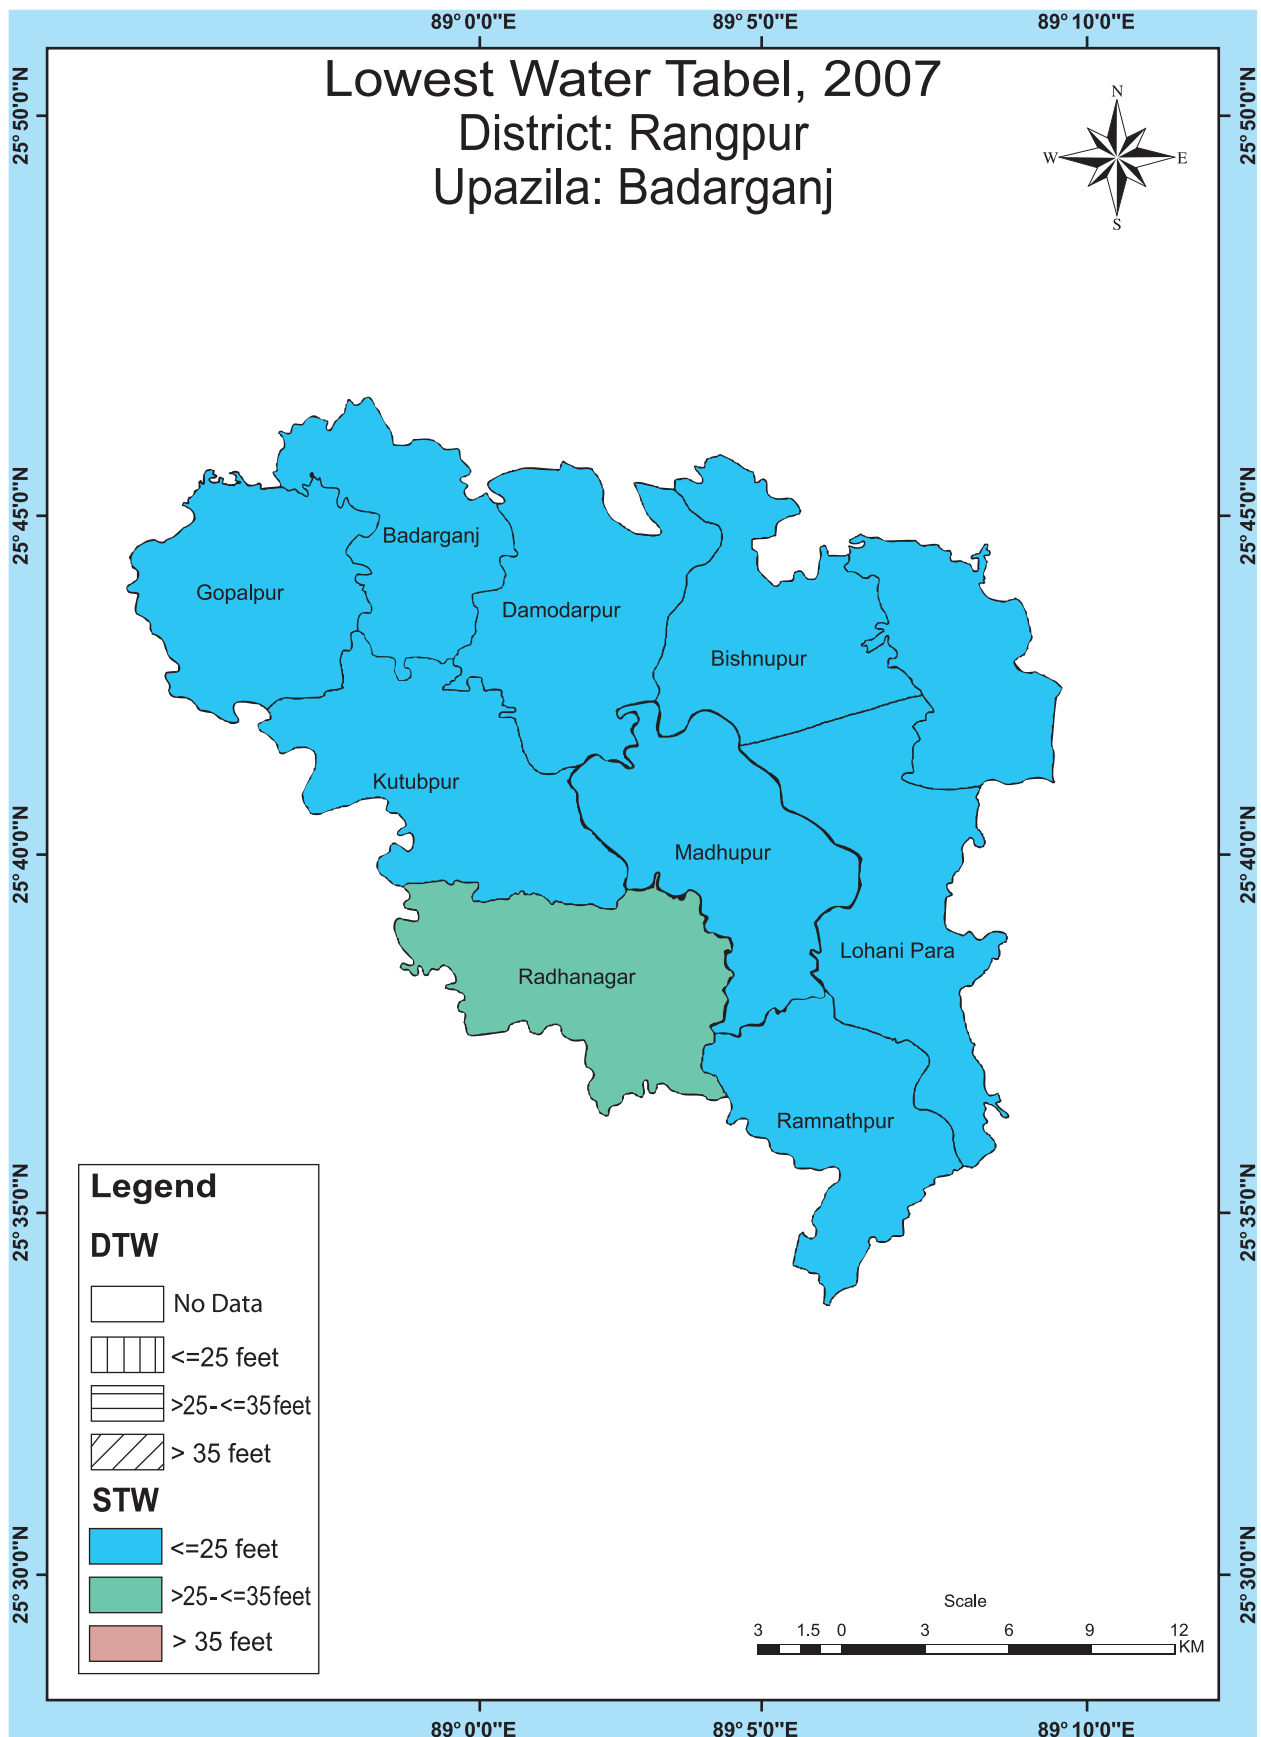
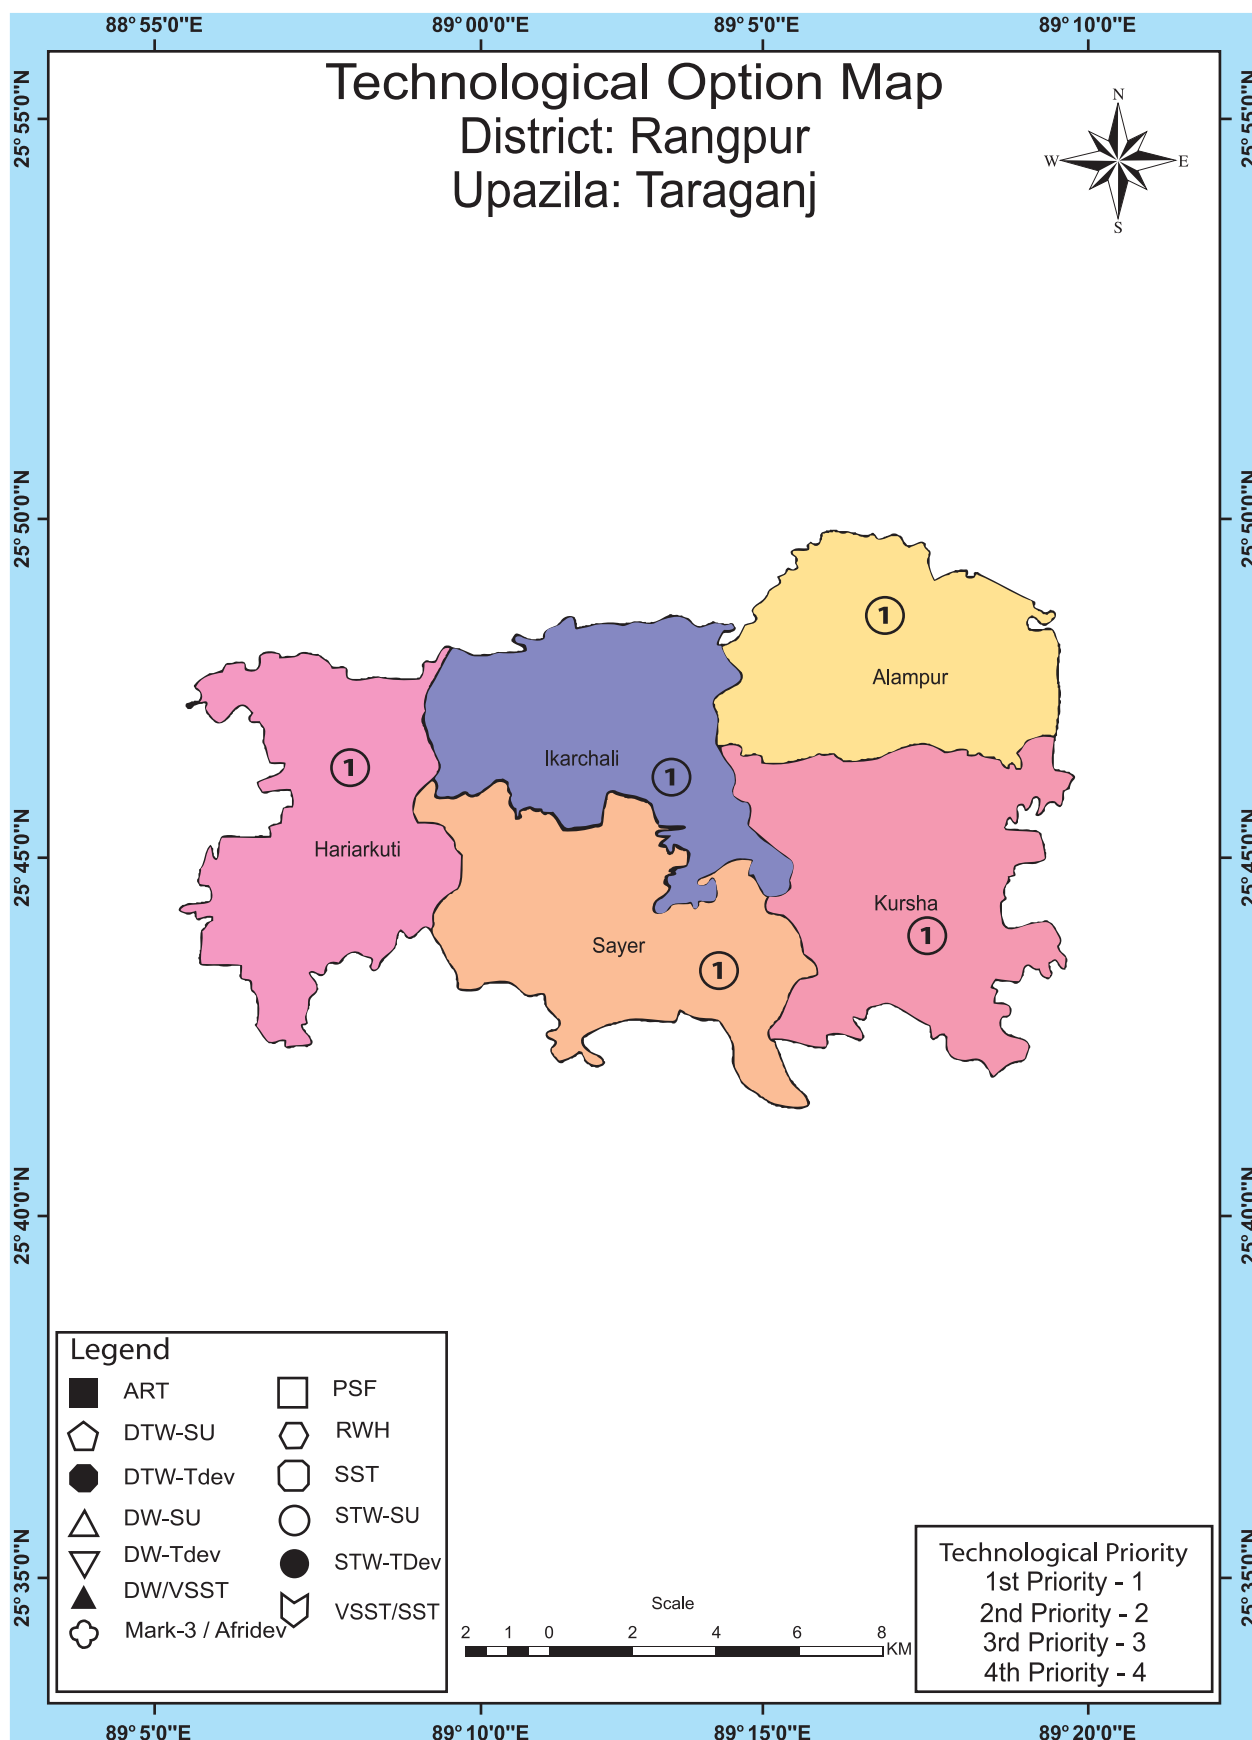


Table
For
Mapping on 'Water Supply Technology' under "GOB-UNICEF Project"

District Name	Upazila Name	Union Name	Water Supply Technology										Remark				
			Lowest Water Table (LWT), 2007 in Feet	% TW As Contamination	Fe Problem (>5 ppm) Yes/No		Cl Problem (>600 ppm) Yes/No		Technology option as per 1993	Average depth of Tube well in Feet	Recommended options on the priority basis:						
					STW	DTW	STW	DTW			STW	DTW		1	2	3	4
Rangpur	Taraganj	Alampur	19	-	N/D	Yes	-	No	-	60	-	STW-SU	-	-	-	-	
Rangpur	Taraganj	Hariarkuti	14	-	N/D	Yes	-	No	-	60	-	STW-SU	-	-	-	-	
Rangpur	Taraganj	Ikarchali	17	-	N/D	Yes	-	No	-	60	-	STW-SU	-	-	-	-	
Rangpur	Taraganj	Kursha	18	-	N/D	Yes	-	No	-	60	-	STW-SU	-	-	-	-	
Rangpur	Taraganj	Saver	17	-	N/D	Yes	-	No	-	60	-	STW-SU	-	-	-	-	



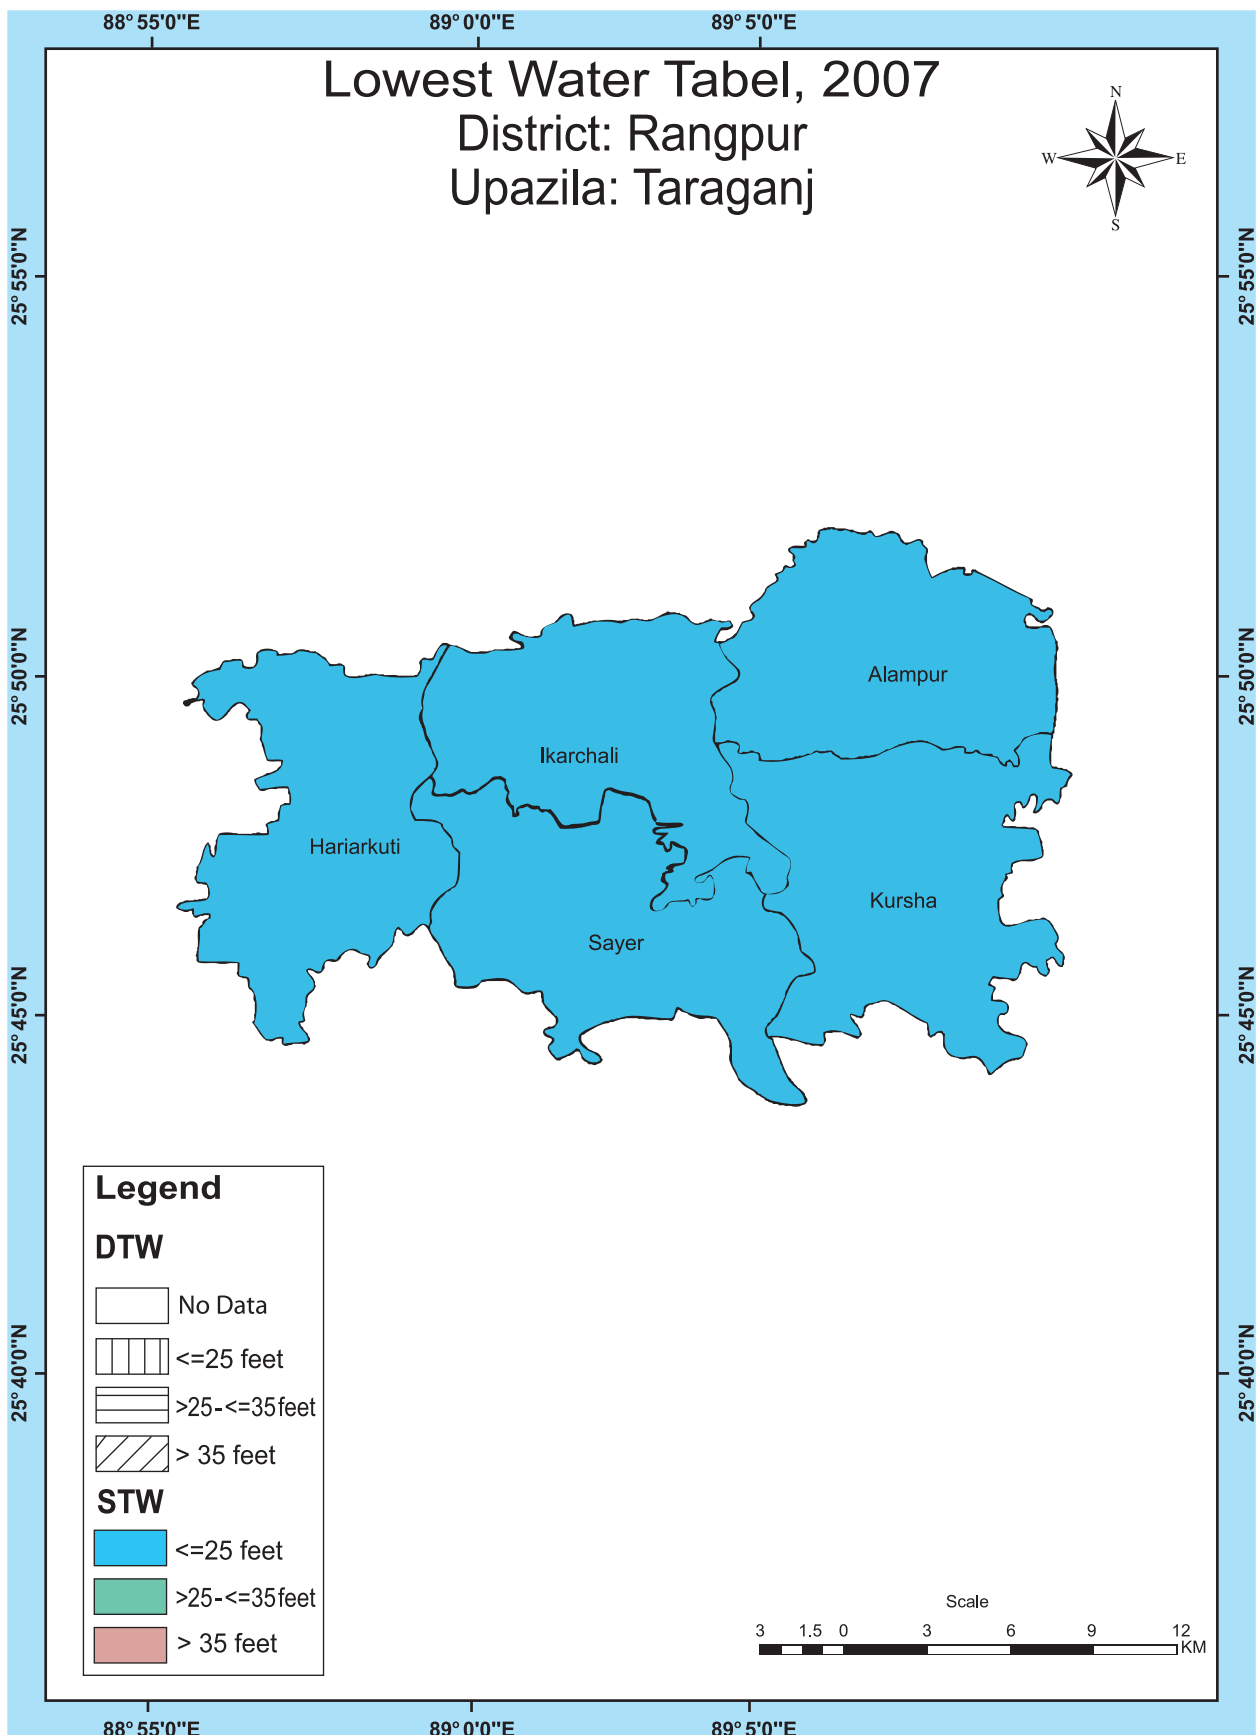


Table
For
Mapping on 'Water Supply Technology' under "GOB-UNICEF Project"

District Name	Upazila Name	Union Name	Water Supply Technology												Remark			
			Lowest Water Table (LWT), 2007 in Feet	% TW As Contamination	Fe Problem (>5 ppm) Yes/No	Cl Problem (>600 ppm) Yes/No	Technology option as per 1993	Recommended options on the priority basis:										
								STW	DTW	STW	DTW	STW	DTW	1		2	3	4
Rangpur	Gangachara	Alam Biditar	17	-	N/D	No	-	No	-	N/D	N/D	-	STW-SU					
Rangpur	Gangachara	Betgari	18	-	N/D	No	-	No	-	ST-SU	70	-	STW-SU					
Rangpur	Gangachara	Borobil	16	-	N/D	Yes	-	No	-	ST-SU	70	-	STW-SU					
Rangpur	Gangachara	Gangachara	16	-	N/D	Yes	-	No	-	ST-SU	60	-	STW-SU					
Rangpur	Gangachara	Gojokontho	15	-	N/D	Yes	-	No	-	ST-SU	70	-	STW-SU					
Rangpur	Gangachara	Kholeya	17	-	N/D	Yes	-	No	-	ST-SU	65	-	STW-SU					
Rangpur	Gangachara	Kolkunda	17	-	N/D	Yes	-	No	-	ST-SU	75	-	STW-SU					
Rangpur	Gangachara	Laksmitari	16	-	N/D	Yes	-	No	-	ST-SU	70	-	STW-SU					
Rangpur	Gangachara	Mornea	15	-	N/D	Yes	-	No	-	ST-SU	60	-	STW-SU					
Rangpur	Gangachara	Nohaly	16	-	N/D	No	-	No	-	N/D	N/D	-	STW-SU					

